

## Implausible torque request after mounting a spare part valvebody in TYPE 251 with M272

Topic number	LI27.00-P-055810
Version	1
Design group	27.00 General
Date	03-06-2013
Validity	TYPE 251 with engine M272 MY 2006 only
Reason for change	
Reason for block	

**Complaint:**

Fault codes in the gearbox-ECU (061B) together with (0845) in the engine-ECU. Less comfortable gearshifts may occur.

**Cause:**

Software.

**Remedy:**

Remedy 1:

Please mount either the valvebody with the part number A 220 270 13 06 or A 220 270 21 06 with index 80 each. Please be sure to order the valvebody which is approved for the particular vehicle.

If one of the mentioned valvebodies can not be delivered, please perform remedy 2.

Remedy 2:

Please mount either the valvebody with the part number A 220 270 27 06 or A 220 270 29 06, followed by contacting the SDS-hotline who will provide a flashback-CD of the engine ECU with the software installed initially.

If one of the mentioned valvebodies with the part number A 220 270 27 06 or A 220 270 29 06 has been mounted lately, please contact the SDS-hotline to provide a flashback-CD immediately.

<b>Symptoms</b>							
Power transmission / Automatic transmission / Automatic transmission - function / General							
Power transmission / Automatic transmission / Automatic transmission - function / Shifts							
Power transmission / Automatic transmission / Automatic transmission - function / Poor shift quality							
Power generation / Engine management / Engine management, function / Nonfunctional							

<b>Parts</b>							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma-

							ke part
A 220 270 13 06	80		valvebody	1	VGS2	X	
A 220 270 28 06	80		valvebody	1	VGS2	X	
A 220 270 29 06	80		valvebody	1	VGS2	X	

Validity		
Vehicle	Engine	Transmission
R (251)	272.967	722.906

Full model designation breakdown		
Vehicle	Engine	Transmission
251.056	272.967	722.906
251.065	272.967	722.906
251.156	272.967	722.906
251.165	272.967	722.906