

## Cover of storage slot at front under roof liner (FF8) not fitting

Topic number	LI68.30-N-059117
Version	1
Design group	68.30 Coverings, trim
Date	05-27-2014
Validity	Model 906 with CODE FF8 (1 DIN slot at front under headliner)
Reason for change	
Reason for block	

**Complaint:**

Cover (1) of storage slot at front under roof liner (FF8) not fitting.

**Cause:**

Minimum dimensions of the cutout in roof liner is too large leading to an insufficient overlap by the cover (1) (A 906 695 0130).

**Remedy:**

1. Remove cover (2) or installed electrical equipment
2. Remove carrier
3. Unclip cover (1)
4. Cut felt strip (3) to size (dimensions: 240mm x 5mm)
5. Stick felt strip (3) onto bottom of cover (1) (see Figure 02 and Figure 03)
6. Assemble in the reverse order

Attachments	
File	Description
01.jpg	Storage slot at front under roof liner
02.jpg	Positioning of felt strip (3)
03.jpg	Felt strip (3) attached

Symptoms
Body / Interior equipment / Interior trim / Bad fitting

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 000 983 89 10			Felt strip	1	(Cut to 240mm x 5mm). Can be used for several vehicles.	X	

---



Validity		
Vehicle	Engine	Transmission
Sprinter III	*	*

## Attachments

01.jpg:



02.jpg:

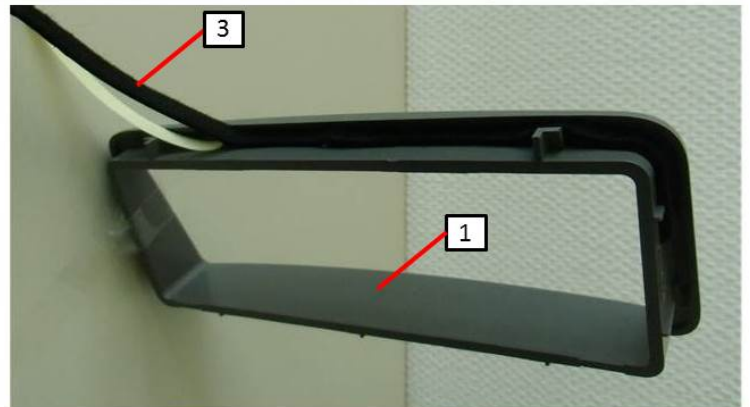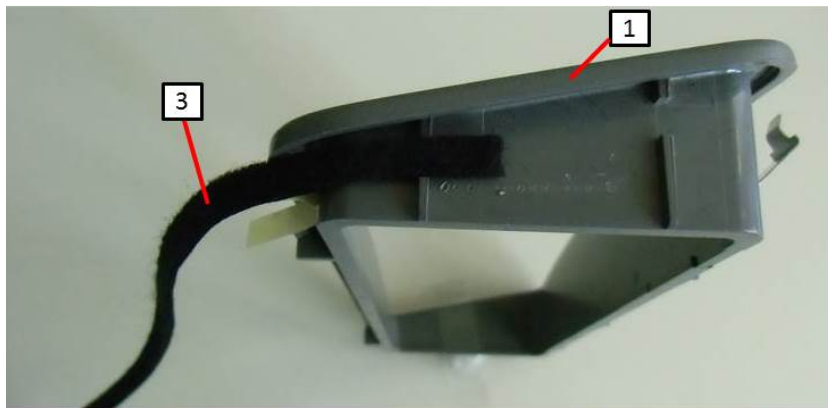

03.jpg:

