



TECHNICAL SERVICE BULLETIN

Gearshift Selector Lever Bezel Door Binding, Skewed And/Or Not Latching

18-2088

15 March
2018

Model:

Ford 2014-2018 Police Interceptor Sedan
2014-2018 Taurus

Issue: Some 2014-2018 Taurus and Police Interceptor Sedan vehicles may exhibit the gearshift selector lever bezel door binding, skewed and/or not latching. This may be due to the door post becoming detached from the bezel door pivot linkage.

Action: Follow the Service Procedure steps to correct the condition.

Parts

Part Number	Description	Quantity
54045A76	Gearshift Selector Lever Bezel – Refer To The Parts Catalogue For The VIN Specific Application	1

Warranty Status: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2014-2018 Taurus and Police Interceptor Sedan: Inspect And Repair Or Replace Selector Lever Bezel (Do Not Use With Any Other Labor Operations)	182088A	0.4 Hrs.

Repair/Claim Coding

Causal Part:	54045A76
Condition Code:	42

Drive	Tool Name
1/4"	Power Tool
1/4"	Ratchet
1/4"	6" Extension
1/4"	7 mm Socket
	Trim Tool

Service Procedure

1. Inspect the door pivot pin and pivot pin linkage for damage. Is any damage present? (Figures 1 - 2)
 - (1). Yes - replace the gearshift selector lever bezel. Refer to Workshop Manual (WSM), Section 307-05.
 - (2). No - proceed to step 2.

Figure 1


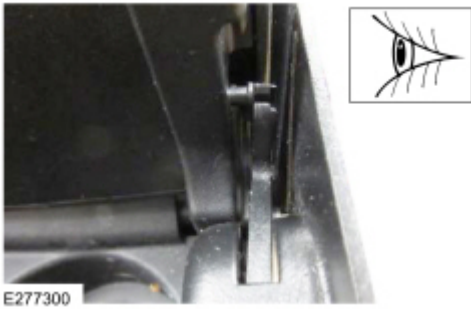


Figure 2



2. Gently pull up on the edge of the door and align with the linkage, then snap the pivot post into the pivot linkage and cycle the lid to verify proper operation. Does the door function properly? (Figure 3)
- (1). Yes - repair is complete.
 - (2). No - replace the gearshift selector lever bezel. Refer to WSM, Section 307-05.

Figure 3

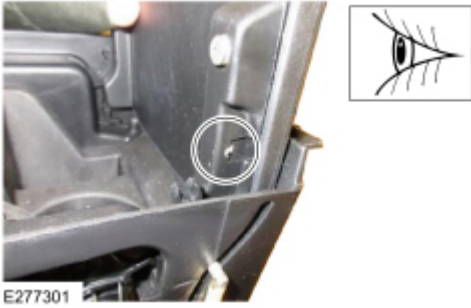

© 2018 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.