

Latest Vehicle Concern Fixes



Vehicle	Customer Concern	Details and Status	Publication
F-PACE	A Customer may report a brake squeal from the front of the vehicle during braking.	A squeal noise from front brakes whilst braking with light brake pedal application (17 inch brakes 325mm brake disc only) is currently under investigation. If a customer reports this concern, please replace the brake pads (T4N13434) and submit an EPQR for the concern.	SSM73713 Published January 11 th .
Discovery 17MY	A customer may report a suspension warning message displayed on the Instrument Cluster.	It may be reported by the customer that a hissing or single pop noise was heard. The vehicle then displays a suspension warning message on the Instrument Cluster (IC), which can lead to a loss of functionality to the vehicle's suspension ride height adjustment. Service Action N141 has been published to proactively replace the Vehicle Dynamic Suspension air supply unit expansion chamber. Parts are in limited supply. A temporary parts restriction has been put on the parts to ensure an equitable distribution. This will be an Owner Notified Campaign.	N141NAS1
XF 16 – 17MY	A customer may report the feedback vibration for Lane Departure is insufficient.	Insufficient steering wheel vibration during a lane departure warning system event may be evident. This may be caused by a Power Steering Control Module (PSCM) calibration error. Should a Customer express a concern, please refer to TSB JTB00601 to configure the Power Steering Control Module (PSCM).	JTB00601NAS1