

- ATTENTION:**
- GENERAL MANAGER
 - PARTS MANAGER
 - CLAIMS PERSONNEL
 - SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.

© 2017 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY: 2017MY Legacy and Outback 2.5i Premium Models with EyeSight

NUMBER: 07-121-17

DATE: 12/19/17

SUBJECT: DTC B2902

INTRODUCTION:

This bulletin provides a repair procedure to address DTC B2902 which may be stored erroneously due to a specification mismatch. This bulletin applies to a very limited number of early-production 2017 model year vehicles without the auto headlamp leveling (AHL) feature only. **Having the incorrect control module installed has absolutely NO effect on normal headlamp system operation and does not cause any warning lamp(s) to illuminate.** The repair involves replacing the headlamp control module.

PRODUCTION CHANGE INFORMATION:

Correct specification headlamp control modules were incorporated into production starting with the following VINs:

- Legacy: **H*008137**
- Outback: **H*215987**

PART INFORMATION:

The part number for the correct specification headlamp control module is **84051AL080**.

SERVICE PROCEDURE / INFORMATION:

If DTC B2902 is stored in the Headlight Control System, confirm using the VIN and the Subaru Electronic Parts Catalog whether or not the vehicle should be equipped with the Headlamp Leveler sensor. If the vehicle is not equipped with the Headlamp Leveler Sensor, install the new (84051AL080) module. If equipped with the sensor, diagnose the DTC as per the applicable Service Manual.


Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

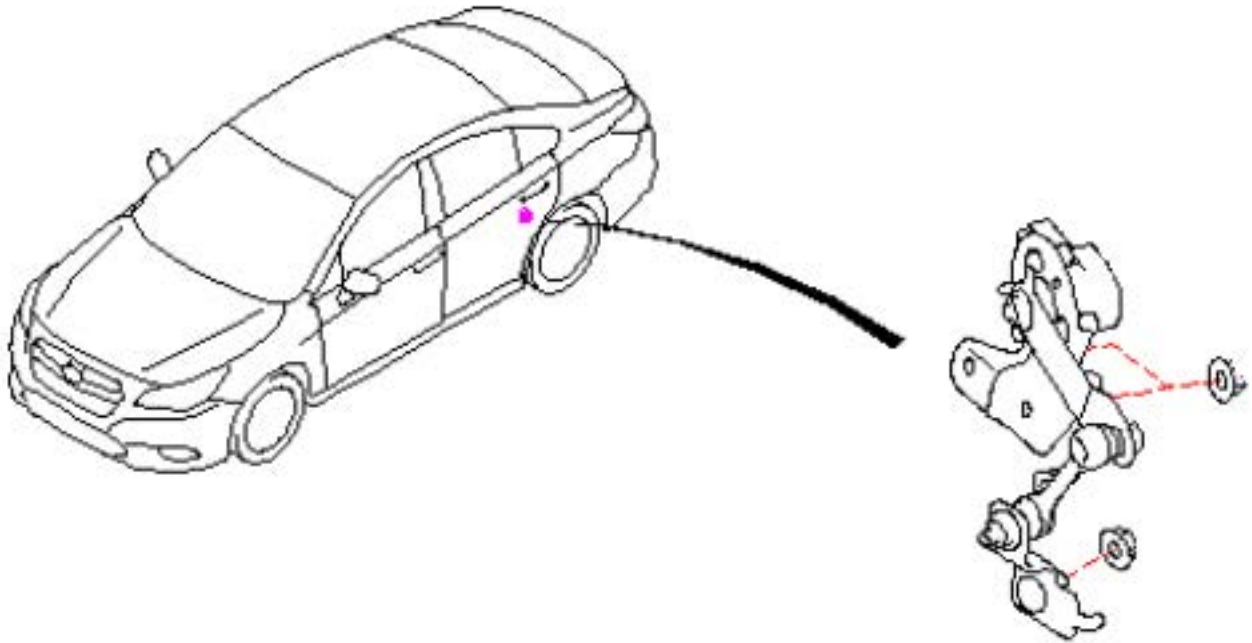

WARRANTY / CLAIM INFORMATION:

For vehicles within the Basic New Car Limited Warranty period or covered by an active Subaru Added Security Classic or Gold plan, this repair may be submitted using the following claim information:

Labor Description	Labor Operation #	Labor Time	Fail Code
AUTO HEADLIGHT LEVELER MODULE R&R	B838-711	0.4	UNK-43
EXTERIOR LIGHT SYSTEM TESTING	C838001	0.5	

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.