

9003413

06/14/2017

MY15 - 17

All Makes

All Bodies

## **GPOP - Issue Review System**

**Part Number:** 53034160A\$, 68044317A\$, 04861714A\$, 04861727A\$, 68043161A\$, 05281418A\$, 05281225A\$, 53032868A\$, 68208213A\$, 52124785A\$, 04581697A\$, 04581652A\$, 04891585A\$

---

**Part Description:** Accelerator Pedal

---

**Issue Description:** Before replacing accelerator pedal, be sure to follow fault code diagnostic procedures in service manual. Make sure to check wiring and connectors. P2122 and P2127 will set if accelerator pedal connector is disconnected during diagnosis. Make sure codes are active before replacing pedal. DTC P2299 is usually caused by a two footed driver and accelerator pedal should not be replaced for this fault.

~ \_\_\_\_\_ ~  
Contact Us at [CAGRIS@Chrysler.com](mailto:CAGRIS@Chrysler.com) for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquiries. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.

---