



**NUMBER:** 08-034-16 REV. A

**GROUP:** Electrical

**DATE:** March 31, 2016

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**THIS BULLETIN SUPERSEDES SERVICE BULLETIN 08-034-16, DATED MARCH 25, 2016, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **\*\*ASTERISKS\*\*** AND INCLUDE REMOVAL OF FB VEHICLE FROM BULLETIN.**

**THE wiTECH SOFTWARE IS REQUIRED TO BE AT THE LATEST RELEASE BEFORE PERFORMING THIS PROCEDURE.**

***SUBJECT:***

RL4 Radio Enhancements

***OVERVIEW:***

This bulletin involves inspecting and, if required, updating the radio software.

***MODELS:***

**\*\*2015 - 2016 (BU) Jeep Renegade\*\***

**NOTE: This bulletin applies to vehicles within the following markets/countries:  
APAC (South Korea).**

**NOTE: This bulletin applies to vehicles built on or after February 13, 2015 (MDH 0213XX) and on or before March 11, 2016 (MDH 0311XX) equipped with Uconnect 6.5 NAV (sales code RL4).**

***SYMPTOM/CONDITION:***

A small number of customers may experience one or more of the following:

- ParkSense audio delay.
- Forward Collision Warning (FCW) turns off spontaneously after key on and FCW warning light is on.


***DIAGNOSIS:***

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available, verify the audio system is operating properly. If audio DTCs are present, record them on the repair order and repair as necessary before proceeding further with this bulletin.

***REPAIR PROCEDURE:***

1. Has the USB flash drive been created?
  - a. Yes >>> Proceed to [Step #5](#).

- b. No >>> Proceed to [Step #2](#).
2. Go to DealerCONNECT> Service> UCONNECT Information & Utilities> Uconnect Dealer software downloads to download the files.
3. If a security message appears “Do you want to view only the webpage content that was delivered securely?” see ([Fig. 1](#)). Press **No** to continue.

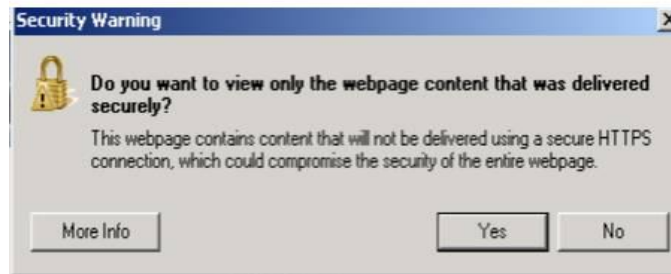

***Fig. 1 Pop-up Security Message***

**NOTE: A blank USB flash drive must be used to download the software. Only one software update can be used on one USB flash drive.**

**NOTE: If the dealer cannot download the software, make sure you have proper security access. If not, have the Service Manager or Shop Foreman download the software update.**

4. To download the software files to a USB flash drive, follow the on screen instructions and perform the following.
  - a. Acquire a blank USB flash drive with at least 4 gb of space.
  - b. Download the software update file to your local pc's desktop.
  - c. Be sure to extract the file before copying it to the blank USB flash drive.
  - d. A blank USB flash drive will be needed one for each radio update, additional updates can not be on the same USB flash drive.
  - e. Once the file is saved to the USB flash drive, it is recommended you physically label the USB flash drive with the bulletin number and proper radio sales codes.
5. With the engine running and radio powered on, insert the **correct** USB flash drive with new software into USB port.
6. The next screen display will have the old and new software levels. The radio will be updated to 16.09.45.
7. Is the radio at software level 16.09.45 or higher?
  - a. Yes>>> The radio software is already up to date. The bulletin is now complete **use LOP 18-60-02-JJ**.
  - b. No>>> The radio software needs to be updated. Proceed to [Step #8](#).

**CAUTION: If the radio software level is at or above the level on the USB flash drive, DO NOT perform the update.**

8. Press the soft key “Yes” to start the update.

**NOTE: If the software update process is interrupted, aborted or failed, the process should be restarted.**

**NOTE: Do not cycle the ignition or touch the radio during the update process.**

9. The update may take up to 20 minutes to load. No other actions will be needed to initiate the update.

10. After the update is done, the screen will display the software levels again.

11. Press “No” and turn the vehicle off. Open and close the driver’s door and let the Bus go to sleep.

**NOTE: Make sure to leave ignition off, do not press the brake, and do not reopen any doors so the modules will go to sleep.**

12. Cycle the ignition on, then back off one more time. Open and close the driver’s door and let the Bus go to sleep. This will complete the radio update.

13. Remove the USB flash drive; the bulletin is now complete.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

<b>Labor Operation No:</b>	<b>Description</b>	<b>Skill Category</b>	<b>Amount</b>
18-60-02-JJ	Radio, Check Software Level Only (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.
18-60-02-JK	Radio, Check Software Level and, Perform Software Update (0 - Introduction)	6 - Electrical and Body Systems	0.6 Hrs.
18-60-02-JL	Radio, Software - Create USB flash drive, Uconnect Website (One Time Only) (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs.

**NOTE: The “One Time Only” LOP is used one time per dealer when downloading the software onto a USB flash drive. The dealer can only use the download LOP, one time for each of the radios listed.**

**NOTE: The expected completion time for the flash download portion of this procedure is approximately 12 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.**

***FAILURE CODE:***

**The dealer must choose which failure code to use. If the customer came in with an issue and if the dealer finds a software update to correct that issue, use failure code CC, for all other use failure code RF.**

- If the customer's concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used.
- If an available flash is completed while addressing a different customer concern, failure code RF is to be used.

CC	Customer Concern
RF	Routine Flash