


MIL "ON" DTC P030# and/or Runs Rough on Cold Start

Service Category Engine/Hybrid System

Section Engine Control

Market USA

Lexus Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2010 – 2017	RX450H	

REVISION NOTICE

December 13, 2017 Rev1:

- **Applicability has been updated to include 2013 – 2017 model year RX 450h vehicles.**
- **The Introduction and Repair Procedure sections have been updated.**

Any previous printed versions of this bulletin should be discarded.

Introduction

Some 2010 – 2017 model year RX 450h vehicles may exhibit one or more of the following conditions:

- MIL "ON" with DTC P0300/00, P0301/00, P0302/00, P0303/00, P0304/00, P0305/00, and/or P0306/00 present
- Rough running on initial start-up after a cold soak

Follow the Repair Procedure in this bulletin to address these conditions.

MIL "ON" DTC P030# and/or Runs Rough on Cold Start

Warranty Information

MODEL YEAR	OP CODE	DESCRIPTION	TIME	OFF	T1	T2
2010 – 2015	895221	Replace Fuel Injectors	2.6	23209-31090 23209-0P010	8A	88
2016 – 2017			3.7	23209-31130		

APPLICABLE WARRANTY

- This repair is covered under the Lexus Federal Emission Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- For 2011 – 2012 model year California specification vehicles sold, registered, and operated in Arizona (2012 model year ONLY), California, Connecticut, Maine, Maryland, Massachusetts, New Jersey, New Mexico (2011 model year ONLY), Oregon, Pennsylvania, Rhode Island, Vermont, and Washington, this repair is covered under the California Long Term Emission Warranty, which is in effect for 84 months or 70,000 miles, whichever occurs first, from the vehicle's in-service date. California specification vehicles shipped to other states do NOT assume coverage under the California Long Term Emission Warranty.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

MODEL YEAR	PART NUMBER		PART NAME	QTY
	PREVIOUS	NEW		
2010 – 2015	23209-31090	23209-31160	Injector Set, Fuel	6
	23209-0P010			
	23291-28020	23291-28020	Injector Set, Fuel	6
	23291-0V020			
	17176-0P021	17176-0P021	Gasket, Air Surge Tank to Intake Manifold	3
	17176-31090			
	25627-31030		Gasket, EGR Valve	1
	17179-31010		Gasket, Intake Manifold	1
	25629-31030		Gasket, EGR Pipe, No. 2	1
	25628-31010		Gasket, EGR Inlet	1

MIL "ON" DTC P030# and/or Runs Rough on Cold Start

Parts Information (Continued)

MODEL YEAR	PART NUMBER		PART NAME	QTY
	PREVIOUS	NEW		
2016 – 2017	23209-31130	23209-31190	Injector Set, Fuel	6
	23291-23010	23291-23010	Insulator, Injector Vibration	6
	23291-31030			
	23291-0P010			
	17177-31070	17177-31070	Gasket, Intake Manifold to Head, No. 1	2
	17177-0P030			

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
Techstream 2.0*	ADE	TS2UNIT	1
Techstream Lite		TSLITEPDLR01	
Techstream Lite (Green Cable)		TSLP2DLR01	

* Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 12.20.024 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

MIL "ON" DTC P030# and/or Runs Rough on Cold Start

Repair Procedure

1. Confirm the engine runs rough on initial start-up AFTER cold soak or using Techstream, check for ANY of the following stored DTCs:

- P0300/00 – Random/Multiple Cylinder Misfire Detected.
- P0301/00 – Cylinder 1 Misfire Detected.
- P0302/00 – Cylinder 2 Misfire Detected.
- P0303/00 – Cylinder 3 Misfire Detected.
- P0304/00 – Cylinder 4 Misfire Detected.
- P0305/00 – Cylinder 5 Misfire Detected.
- P0306/00 – Cylinder 6 Misfire Detected.

Are ANY of the DTCs present?

- **YES** — Continue to step 2.
- **NO** — This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.

2. Perform the misfire diagnosis.

Refer to the Technical Information System (TIS), applicable model year Repair Manual:

- [2010 \(to 08/2009\)](#) / [2010 \(from 08/2009\)](#) / [2011](#) / [2012](#) / [2013](#) / [2014](#) / [2015](#) / [2016](#) / [2017](#) RX 450h:
Engine/Hybrid System – Engine Control – “2GR-FXE Engine Control: SFI System: P0300-P0306: Random / Multiple Cylinder Misfire Detected”

3. If no concerns are noted with the mechanical engine condition, engine control system, ignition system, or fuel supply system, remove the fuel injectors and visually inspect the fuel injector tips for signs of debris.

Is there debris on ANY of the fuel injector tips?

- **YES** — Continue to step 4.
- **NO** — This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.

MIL "ON" DTC P030# and/or Runs Rough on Cold Start

Repair Procedure (Continued)

4. Replace ALL six fuel injectors.

Refer to TIS, applicable model year Repair Manual:

- 2010 RX 450h:
Engine/Hybrid System – Fuel System – “2GR-FXE Fuel: Fuel Injector: [Removal \(to 08/2009\)](#) / [Removal \(from 08/2009\)](#) / [Installation \(to 08/2009\)](#) / [Installation \(from 08/2009\)](#)”
- 2011 RX 450h:
Engine/Hybrid System – Fuel System – “2GR-FXE Fuel: Fuel Injector: [Removal](#) / [Installation](#)”
- 2012 RX 450h:
Engine/Hybrid System – Fuel System – “2GR-FXE Fuel: Fuel Injector: [Removal](#) / [Installation](#)”
- 2013 RX 450h:
Engine/Hybrid System – Fuel System – “2GR-FXE Fuel: Fuel Injector: [Removal](#) / [Installation](#)”
- 2014 RX 450h:
Engine/Hybrid System – Fuel System – “2GR-FXE Fuel: Fuel Injector: [Removal](#) / [Installation](#)”
- 2015 RX 450h:
Engine/Hybrid System – Fuel System – “2GR-FXE Fuel: Fuel Injector: [Removal](#) / [Installation](#)”
- 2016 RX 450h:
Engine/Hybrid System – Fuel System – “2GR-FXE Fuel: Fuel Injector: [Removal](#) / [Installation](#)”
- 2017 RX 450h:
Engine/Hybrid System – Fuel System – “2GR-FXE Fuel: Fuel Injector: [Removal](#) / [Installation](#)”

5. Clear ALL stored DTCs.
6. Start the engine and confirm the repair.