

F-Sport Rear Lowering Coil Spring Click Noise

Service Category Suspension

Section Rear Suspension

Market USA

Lexus Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2006 – 2009	IS250, IS350	

REVISION NOTICE

May 26, 2016 Rev1:

- The Repair Procedure has been updated.

Any previous printed versions of this bulletin should be discarded.

Introduction

Some 2006 – 2009 model year IS vehicles equipped with F-Sport Rear Lowering Coil Springs may exhibit a clicking noise from the rear suspension when driving. New Rear Lowering Coil Springs are available to address this condition. Follow the Repair Procedure in this bulletin to replace the Rear Lowering Coil Springs.

Parts Information

PART NUMBER	PART NAME	QTY
PTR07-53091	Lowering Springs, Rear	1

F-Sport Rear Lowering Coil Spring Click Noise

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
482151	R & R Rear Coil Spring (One Side)	1.4	PTR07-53080	91	50
Combo A	Opposite Side	0.8			
Combo D	Adjust Toe-in	0.2			

APPLICABLE WARRANTY

- **F-Sport Performance Parts** installed as original equipment are covered under the Lexus Accessory Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- **F-Sport Performance Parts** installed by a Lexus dealer are warranted for 12 months, regardless of mileage, from the date of installation on the vehicle, or the remainder of the applicable New Vehicle Limited Warranty, whichever provides the greater coverage.
- **F-Sport Performance Parts** purchased over-the-counter are covered for 12 months from the date of purchase.
- **Warranty application** is limited to occurrence of the specified condition described in this bulletin.

Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST'S)	PART NUMBER	QTY
Plastic Pry Tool Set*	00002-06000-01	1
Strut Spring Compressor (Model 7200)	BRNM-ST7200	1

* Essential SST.

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

Repair Procedure

1. Confirm that the vehicle is equipped with F-Sport accessory lowering springs.
2. Confirm the condition as described in the Introduction.

Is the noise present?

- **YES** — Continue to step 3.
- **NO** — This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.

F-Sport Rear Lowering Coil Spring Click Noise

Repair Procedure (Continued)

3. Replace both Rear Lowering Coil Springs.

Please reference the Accessory Installation procedure found on the Technical Information System (TIS):

["2006-2013 IS 250-350 F Sport Lowering Springs PTR07-53090, PTR07-53091 Rev. B"](#)

4. Perform wheel alignment. Verify the condition is no longer present.