

B-pillar trim chafed through at height of seat belt outlet

Topic number	LI68.30-P-059216
Version	6
Function group	68.30 Coverings, trim
Date	03-16-2018
Validity	Model series 117 up to VIN end number 204196 BR 292 up to production month 11/2017
Reason for change	BR292 added
Reason for block	

Complaint:

The B-pillar trim is chafed through at the height of the belt outlet.

Attachments	
File	Description
CLA 001.jpg	Complaint
CLA 002.jpg	Complaint
CLA 004.jpg	Complaint
CLA 008.jpg	Complaint
CLA 009.jpg	Complaint

Cause:

The seat belt may chafe through the B-pillar trim.

Remedy:

Replacement of B-pillar trim with modified parts.

Symptoms
Body / Interior equipment / Interior trim / Deformed
Body / Interior equipment / Interior trim / Bad fitting
Body / Interior equipment / Interior trim / Pressure mark

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 117 690 57 00			Left B-pillar trim	1	Please observe color code	X
A 117 690 58 00			Right B-pillar trim	1	Please observe color code	X
A 292 690 71 00			Left B-pillar trim	1	Without code 581, 61U	X
A 292 690 72 00			Right B-pillar trim	1	Without code 581, 61U	X
A 292 690 75 00			Left B-pillar trim	1	With code 581, without code 61U	X

XENTRY TIPS

A 292 690 76 00		Right B-pillar trim	1	With code 581, without code 61U	X
A 292 690 73 00		Left B-pillar trim	1	With code 61U, without code 581	X
A 292 690 77 00		Left B-pillar trim	1	With code 581 and 61U	X
A 292 690 78 00		Right B-pillar trim	1	With code 581 and 61U	X

Attachments

CLA 001.jpg:



XENTRY TIPS

CLA 002.jpg:



XENTRY TIPS

CLA 004.jpg:



XENTRY TIPS

CLA 008.jpg:



CLA 009.jpg:

