

Trunk lid does not open/close

Topic number	LI88.50-P-067885
Version	1
Function group	88.50 Trunk lid
Date	03-16-2018
Validity	MODEL 238.3 with code 881 produced before Feb 16 2018
Reason for change	
Reason for block	

Complaint:

- Trunk lid does not open/close completely.
- Noises when the trunk lid is operated.
- Left trunk lid hinge cover (picture 1, A) damaged.

Attachments	
File	Description
Bild 1.JPG	Picture 1

Cause:

In isolated cases, the molded bearing (picture 2, A) of the trunk lid control drive unit (picture 2, B) can detach from the bodyshell.

Attachments	
File	Description
Bild 2.JPG	Picture 2

Remedy:

Replace the installed molded bearing on the bodyshell with the new version.
If necessary, also replace the trunk lid hinge cover.

Symptoms
Body / Door/Flap / Hood/flap / Trunk lid/liftgate / Opens incompletely
Body / Door/Flap / Hood/flap / Trunk lid/liftgate / Does not open
Body / Door/Flap / Hood/flap / Trunk lid/liftgate / Noise

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 238 750 71 00			Molded bearing	1		X
A 205 821 27 89			LEFT TRUNK LID HINGE CA- BLE DUCT	1		X

XENTRY TIPS

Operation numbers/damage codes


Op. no.	Operation text	Time	Damage code	Note
			8211C 06	

Attachments

Bild 1.JPG:



Bild 2.JPG:

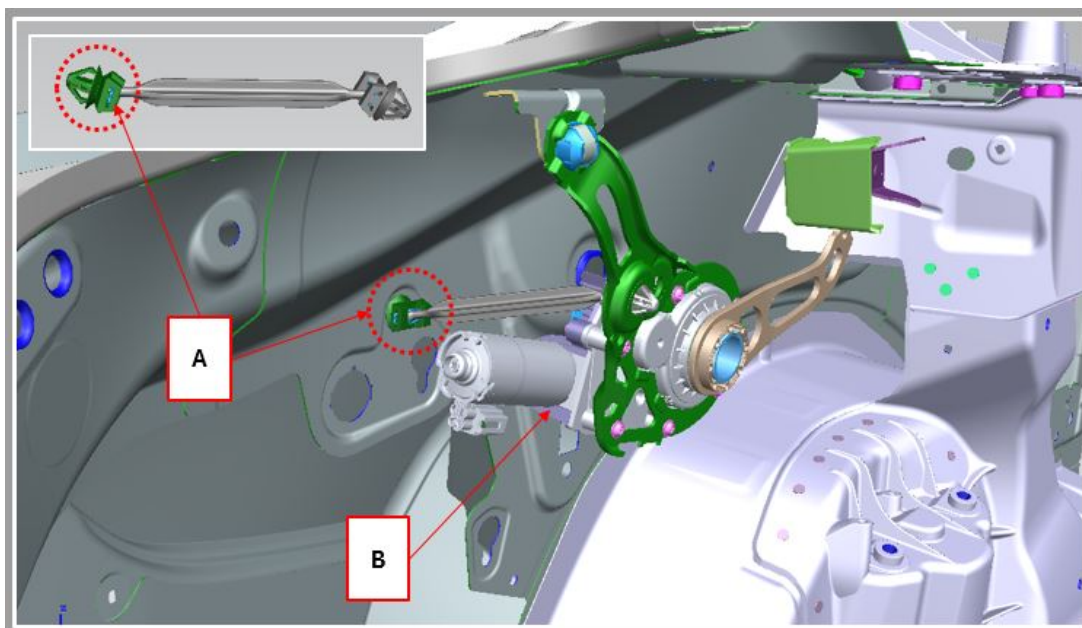

XENTRY TIPS
