

"Tire pressure loss detection system inoperative" message in instrument cluster in yellow.

Topic number	LI42.47-P-068271
Version	1
Function group	42.47 Adaptive Brake (ABR)
Date	06-20-2018
Validity	205, 253 w/code 477 (Tire pressure loss warning system)
Reason for change	
Reason for block	

Complaint:

The "Tire pressure loss detection system inoperative" message appears sporadically (for approx. 1-2 seconds) in the instrument cluster in yellow whilst driving or after engine start.

Note:

No fault codes are entered into the ESP control unit (N30/4).

All tires have the correct tire pressure.

Cause:

Possibly software.

Remedy:

Update of ESP software.

Note:

Software is available with

- DVD 12/2017 and add-on 9782
- DVD 03/2018 and add-on 9783
- from DVD 05/2018 without add-on

Symptoms

Chassis/suspension / Wheels/tires / Tire pressure loss warning display / Display in yellow / Run Flat Indicator Inoperative

XENTRY TIPS

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			43181 90	