



Technical Service Bulletin

21 Engine difficult to start, turbocharger damaged, V8 4.0TFSI

21 18 28 2044640/3 May 14, 2018. Supersedes Technical Service Bulletin Group 21 number 17-27 dated November 21, 2017 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8, S7, S8, S8+, RS7, and RS7+	2016	All	4.0L
A8	2017	000001 - 019190	4.0L
S8	2017	000001 - 901368	4.0L
S7	2017	000001 - 115286	4.0L
RS7, RS7+	2017	000001 - 904264	4.0L

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised header data (Added VIN breaks for 2017 models) Revised <i>Production Solution</i> (Added information) Revised <i>Service</i> (Added Note and updated Step 7) Revised <i>Required Parts and Tools</i> (Added part numbers)
2	11/21/2017	Revised <i>Required Parts and Tools</i> (Updated quantity and part numbers)
1	02/02/2017	Initial publication

Customer statement:

- Engine cannot be started or only with difficulty.
- Engine makes unusual noises when accelerating.
- Engine has reduced performance.

Workshop findings:

- Damage on turbocharger impeller fins, increased free play on impeller shaft of turbocharger or broken impeller shaft.



Technical Service Bulletin

Technical Background

Damage to the turbocharger is rarely directly the result of turbocharger failure. Therefore, it is important to perform further checks to find the root cause, to avoid repeat repairs.

Known causes for turbocharger damage:

- Performance increases by tuned ECM
- Non-compliance with service intervals
- Incorrectly fitted oil filter element
- Leaks in intake tract allowing outside unfiltered air and debris into the turbocharger
- Poor oil supply of turbocharger

Production Solution

Optimized oil strainer 079115175G for oil supply lines to turbochargers in the cover in the inner valley of engine. The oil strainer and check valve 079103175C must always be replaced to ensure proper oil flow to the turbochargers.

Service

1. Perform the Guided Functions with the diagnosis tester: "01 check warranty information." Then check for an entry with the vehicle data in ELSA under warranty code.
 - All information must be documented on attached Checklist and stored with the Repair Order.

2. Check the hardware version of the engine control unit. An X version indicates that the engine control unit was replaced/or is modified (Figure 1).

First system test with DTC memory entries

Address: 0001 System name: 01 - Engine Electronics Protocol versions: UDS/ISOTP	
ASAM base version:	BV_EnginContrModul1UDS
ASAM control module version:	EV_ECM20TFS0208W0906259C_001
Hardware part number:	06L907425
Software part number:	8W0906259C
Hardware version number:	H13
Software version number:	0004
Build group number:	

Figure 1. Correct hardware version number.

3. Check the intake tract for leaks. Review the repair history for possible previous repairs on the intake tract.
4. Measure the oil pressure at idle and 2000 rpm according to ElsaPro.



Technical Service Bulletin

5. Visually assess the condition of the damaged turbocharger from both sides. No oil marks (charge air and exhaust side) could be another indication for a poor oil supply to the turbocharger.
6. Check the oil filter for correct installation and correct filter part number 079115561J. If the oil filter is not centrally fitted, the engine oil may not be filtered, entering the oil supply of the turbocharger due to the crooked position of the oil filter element.
 - Check the installation of the oil filter bypass valve according to service measure 17F2.
 - Check the oil supply line for through flow and oil deposits.
 - Check the oil drain hoses for through flow and oil deposits.

! Note:

This TSB is not replacing any Repair Manual instructions, this TSB is meant to supplement the Repair Manual. See ElsaPro, *Engine >> 8-Cylinder Direct Injection 4.0L 4V TFSI Engine >> 21 Turbocharger >> Turbocharger, Removing and Installing.*

7. Replace both of the turbochargers as well as the **oil strainer** and **check valve** in the inner valley of engine according to ElsaPro and observe all instructions.
8. Change the engine oil including oil filter.
9. Follow the installation instructions in ElsaPro for the turbochargers exactly including:
 - Filling the turbocharger at the supply line connections with engine oil.
 - To ensure the turbocharger is supplied with enough oil, let the engine run at idle for approximately one minute after starting, do not increase rpm.

! Note:

Failure to follow the TSB and ElsaPro instructions may lead to premature turbocharger failure which may be reviewed by Warranty.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.
Service Number:	2130



Technical Service Bulletin

Damage Code:	0010		
Labor Operations:	For all models:		
	Turbocharger replace	2130 5671	50 TU
	Oil pressure check	1703 0199	80 TU
	Check intake and exhaust system for debris, additional time is included in Turbocharger remove + reinstall	2130 0199	20 TU
	Remove + reinstall oil strain and check valve	1726 2099	70 TU
	Check that oil bypass valve is fitted correctly	1701 0199	10 TU
	Engine oil and filter change	1701 1799	40 TU
	For A8 and S8:		
	Air intake distributor remove + reinstall without night camera and radar sensor	2446 1921	470 TU
	Turbochargers remove + reinstall	2130 2071	520 TU
	For S6, S7, and RS7:		
	Turbochargers remove + reinstall	2130 2071	470 TU
	(S6/S7 only) Air intake distributor remove + reinstall without night camera and radar sensor	2446 1921	600 TU
	(RS7 only) Air intake distributor remove + reinstall without night camera and radar sensor	2446 1923	690 TU
Diagnostic Time:	GFF	0150 0000	30 TU
	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
Claim Comment:	As per TSB # 2044640/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools



Technical Service Bulletin

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

Part Number	Part Description	Quantity
079103175C	Check valve	1
079115175G	Oil strainer	1
Order by VIN	Left waste gate vacuum unit with actuator rod	1
Order by VIN	Right waste gate vacuum unit with actuator rod	1
079103161Q	Cover Gasket	1
N 90303801	Lower oil supply o-rings 9x1.5 black	2
N 91056801	Upper oil supply o-rings 12x2 black	2
WHT006901A	Oil return o-rings 14.5x2	2
N 90465003	Water tube o-rings 23x2.6	3
N 90409501	Clamp breather hoses	4
079129717K	Intercooler housing gasket right side	1
079129717J	Intercooler housing gasket left side	1
079145818	Throttle body gasket	1
079103583	Breather seals	3
N 90686902	Spring clips 23x12 breather hoses	4
WHT006335A	Turbo coolant pipe o-rings lines (blue 2.0mm) ⚠ Note: Installed seals are based on which pipes are installed (see TSB 2036167).	4
WHT006537	Turbo coolant pipe o-rings lines (black 2.8mm) ⚠ Note: Installed seals are based on which pipes are installed (see TSB 2036167).	4
WHT001011A	Coolant supply pipe lower o-rings yellow 12.2x1.65	2



Technical Service Bulletin

Order by VIN	Left turbocharger	1
Order by VIN	Right turbocharger	1
WHT005529	Inlet pipe o-rings	2
079253039M	Exhaust manifold gaskets	2
N 90894601	Manifold nuts M8	16
G 052112A3	Hot bolt paste 170G	1
4G0253115D	Turbocharger outlet gaskets	2
N 91153902	Turbocharger studs	10
N 91130802	Manifold nuts	10
N 0138495	Drain plug gasket	1
079198405D	Oil filter kit	1
G 013A8J1G	Coolant additive	1
Outside material	Distilled water (obtained locally)	Shop supply

Tool Number	Tool Description
3371	Gauge – Gap adjustment tool
V.A.G 1342	Oil pressure gauge kit
V.A.G 1274/8	Adapter
V.A.G 1274/10	Adapter
VAS 6096	Cooling system charge unit
T10007 A	Refractometer
	Approved battery charger

Additional Information



Technical Service Bulletin

More information can be found at the following resources:

- ElsaPro, *Engine >> 8-Cylinder Direct Injection 4.0L 4V TFSI Engine >> 21 Turbocharger >> Turbocharger, Removing and Installing.*

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2028842, *01 Automatic detection of unauthorized chip tuning (TD1 warranty key).*
- TSB 2036167, *19 Coolant pipe seepage on turbocharger.*

All parts and service references provided in this TSB (2044640) are subject to change and/or removal.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.