


Solution K15325424 Wednesday, September 26, 2018 9:38:13 PM CEST

Mack Models

Mack Model	LR , LEU , MRU-TerraPro , AN-Anthem , CHU-Pinnacle, Axle back , CXU-Pinnacle, Axel forward , GU-Granite , TD-Titan	
Engine family		
Engine family	MP7, MP8, MP10	
Emission Standard		
Emission Standard	2018, OBD2017, US17, US16, US15, US13 OBD, US14	
** SOLUTION **		
Title	Expired - Mack Chassis - Diagnostic Trouble Code (DTC) P026C Lighting The Malfunction Indicator Light (MIL) - US14+OBD13, US14+OBD15 And US14+OBD16 - Commonly Model Years 2015 To 2017 (Non-Common Rail Fuel System) Chassis	
Cause	US14+OBD13, US14+OBD15 And US14+OBD16 (Commonly Model Years 2015 To 2017) chassis may log DTC P026C.	
Solution	Verify the chassis emissions level	

• Details can be found in the Product Details box on the Product tab in PTT as seen below:

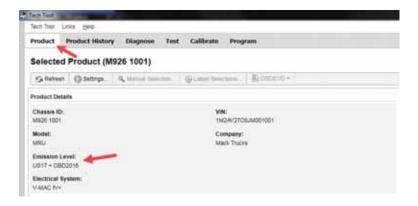

For US14+OBD13

- Refer to <u>FSB 284-066 Engine Control Module (ECM)</u> and Aftertreatment Control <u>Module (ACM)</u>, <u>Reprogramming</u>.
 - This bulletin is current as of 17 April 2018.

For US14+OBD15

- Software improvements have been released to address this code. Refer to the table

below:

Action Required				
ECM	Main Software	Action Required		
MP7 / MP8	Equal or Less Than 22741784	Update to Latest Software		
MP10	Equal or Less Than 22644017	Update to Latest Software		

For US14+OBD16

- Refer to <u>FSB 284-065 Engine Control Module (ECM) and Aftertreatment Control Module (ACM)</u>, Reprogramming.
 - This bulletin is current as of 17 April 2018.

	If any other symptoms or related codes are present, normal diagnostics will need to be performed for them. P026C generating due to software will not cause physical symptoms.
Campaign code	FSB 284-065; FSB 284-066
Solution visibility	Dealer distribution
Function(s)/componen	nt(s) affected
Function affected	FSB , fuel supply , injectors , exhaust , 1 1 0 EMS , 2 1 0 ACM
Function Group	
Function Group	254 catalytic converter; exhaust emission control equipment , 255 turbocharger , 258 emissions after-treatment , 284 control system, fuel supply
Customer effect	
Main customer effect	regeneration, calibration/programming/pairing/missing operation, diagnostics /methodology, efficiency/abnormal behavior, fault code/display
Lights/Messages on information display	⚠Driver's information warning pictogram
Fault code(s)	
OBD 2013 Diagnostic Trouble Codes	P026C00
Conditions	
Vehicle operating mode	when driving, when stationary
Frequency of occurrence of problem	always
External temperature	20 / 30 °C
Administration	
Author	RU4469V

Last modified by	RU4469V
Creation date	17-04-2018 18:04
Date of last update	14-09-2018 14:09
Status	Expired