

<p><b>18MY XCL vehicles equipped with AJ20P</b></p>	<p><b>A customer may complain of a check engine lamp in the instrument cluster and/or poor engine performance</b></p>	<p><b>Diagnosis may find P0191-85 stored in conjunction with multiple other codes related to PCM adaptations. Investigation of the snapshot data for the DTCs stored reveals that P0191-85 was stored first and fuel trims were near the limits. Perform primary and secondary diagnosis including electrical circuit tests for the fuel pressure sensor and smoke test the intake and exhaust systems. For any repair that is made, perform the drive cycle outlined below for validation of the repair.</b></p> <ol style="list-style-type: none"> <li>1. 8 hour engine off soak of the vehicle</li> <li>2. Key on engine <b>OFF</b> for ~3 seconds then start vehicle</li> <li>3. Drive the vehicle and ensure 5 ECO stops complete</li> <li>4. Check for pending or stored DTCs in the PCM</li> </ol>	<p><b>Land Rover: SSM 73959</b></p> <p><b>Jaguar:</b></p> <p><b>SSM 73960</b></p>
---	---	---	---