

**SUBJECT****Service Action: Replace Fuel Door Cover Pot****MODEL**

F16 (X6 sDrive 35i, xDrive 35i)

F86 (X6 M)

SITUATION

Under certain conditions, the fuel door locking pin may become jammed and/or the emergency release pull cable does not function.

AFFECTED VEHICLES

This Service Action involves X6 vehicles produced from August 15, 2014 to February 25, 2015.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

PROCEDURE

Replace the cover pot using Repair Instruction 41 63 003.

Necessary preliminary tasks:

- Remove the right rear wheel.
- Remove the rear right wheel arch cover.
- Remove the flap for the fuel filler neck.
- Close the central locking system with the open fill flap.

Refer to the attachment for the repair procedure.

PARTS INFORMATION

Part Number	Description	Quantity
51 17 7 297 009	Cover pot	1
51 77 7 171 004	Blind rivet	7
51 71 1 958 025	Plastic nut	1

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:	00 51 66 03 00	
---------------------	-----------------------	--

Completion before vehicle delivery to the customer or the vehicle is already in the workshop

Labor Operation:	Labor Allowance:	Description:
00 63 549	Refer to KSD2	Replacing cover pot (Plus work)

Or:

Completion after vehicle delivery to the customer

Labor Operation:	Labor Allowance:	Description:
00 63 017	Refer to KSD2	Replacing cover pot (Main work)

Refer to KSD2 for the corresponding flat rate unit (FRU) allowance.

ADDITIONAL INFORMATION

Perform the procedure outlined in this Service Information on all affected vehicles before customer delivery or the next time they are in the shop for maintenance or repairs.

ATTACHMENTS

View PDF attachment [B511015 Attachment](#).

[Copyright ©2015 BMW of North America, Inc.]