

Measure no.

US 59686312-01

Subject

Speedometer display incorrect

Status date (mm/dd/yy)

7/28/14

Status

Accepted

Organization

US, MOT

Date created (mm/dd/yy)

7/28/14

Created by

Werner Uhrmann

PQM Problem reference**Release date (mm/dd/yy)****Approved by****Dealer release**

Allow automatic release

Vehicles affected**E series**

K21

Engine**Body****Production period (from/to)**

(mm/dd/yy)

10/31/13 / 2/27/14

Comment on production period**Feedback (all cases relating to**

measure up to) (mm/dd/yy)

Complaint

Speedometer displays faster than actual speed.

Cause

ABS control units were programmed with an incorrect wheel circumference, which results

in the speedometer displaying faster than actual speed.

However, the legal regulations are still complied with.

Measure

Flash-program ABS to integration level 14-02-500; this is possible as of ISTA-P version

V52.0 or a more recent version.

Complaint

Fault location	Fault type	Fault place	Fault conditions
Display, speed	Display incorrect / not plausible		Permanent

Cause

#	Fault location	Fault type	Fault place
----------	-----------------------	-------------------	--------------------

1 34/52 Electronic
component (ABS,ASC)

Repair Task	Special Clearance	Area
Program/encode	No	Chassis and Suspension

2 62/11 Instrument cluster

Repair Task	Special Clearance	Area
No action	No	Electrics/Electronics

Fault code

Progman / DIS / ISTA / ISTA/P

System	State	Version
---------------	--------------	----------------