

<b>Reference</b>	SSM73947
<b>Models</b>	Discovery Sport / L550 Range Rover Evoque / L538
<b>Title</b>	AJ20P MIL Illuminated - DTC P144C-00 stored in the PCM
<b>Category</b>	Driveability
<b>Last modified</b>	02-Jul-2018 00:00:00
<b>Symptom</b>	698298 Malfunction Indicator Lamp

**Content**Issue:

The customer reports a MIL and P144C-00 is observed in the PCM.

Cause:

Currently under investigation. Early indications show it is not always due to a leak in the purge line connection, but an issue or repair action that may have caused a fueling adaption drift.

Action:

Investigate and resolve all fuel system DTCs which are, or have historically, flagged in the PCM. Do not replace the purge valve if P144C-00 is set in isolation. Once repairs have been completed, reset the PCM fueling adaption values. Drive the vehicle (a short drive consisting of a highway cruise for approximately 5 minutes and a short city style stop/start drive is sufficient) in order to confirm the vehicle is now repaired prior to returning to the customer.

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.