

<b>Reference</b>	SSM73690
<b>Models</b>	F-PACE / X761 XE / X760 XF / X260
<b>Title</b>	Park Brake and/or ABS warning message on Instrument Cluster - ABS Module DTC`s: C2007-13, C2008-13
<b>Category</b>	Electrical
<b>Last modified</b>	05-Sep-2018 00:00:00
<b>Symptom</b>	203000 Basic Electrical
<b>Attachments</b>	C34A.JPG

**Content****Issue:**

Customer experiences park brake and/or ABS warning message on instrument cluster. Park Brake may not release.

One or more of the following DTC's may be stored in the Anti-lock Brake System Control Module:

**C2007-13 - Right Motor - Circuit Open**

**C2008-13 - Left Motor - Circuit Open**

**C0037 - 14 - Left rear wheel speed sensor - Circuit short to ground or open**

**C0037 - 29 - Left rear wheel speed sensor - signal invalid**

**C0037 - 2F - Left rear wheel speed sensor - signal erratic**

**C003A - 14 - Right rear wheel speed sensor - Circuit short to ground or open**

**C003A - 29 - Right rear wheel speed sensor - signal invalid**

**C003A - 2F - Right rear wheel speed sensor - signal erratic**

**Cause:**

Loose connection at connection C34A – see pictures attached

**Action:**

Check connection at C34A/B in Left hand rear wheel arch

Check for any loose pins/backed out pins

Repair as required as per workshop manual

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.

