



Preliminary Information

PIT3528D Radio Theft Light Inoperative after Radio Replacement and Programming

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Rainier	2004 - 2007	All	All	All	All
Chevrolet	Colorado	2004 - 2009	All	All	All	All
Chevrolet	Trailblazer	2002 - 2009	All	All	All	All
GMC	Canyon	2004 - 2009	All	All	All	All
GMC	Envoy	2002 - 2009	All	All	All	All
Hummer	H3	2006 - 2009	All	All	All	All
Oldsmobile	Bravada	2002 - 2004	All	All	All	All
Saab	97x	2005 - 2008	All	All	All	All

Supersession Statement

This PI was superseded to update model years. Please discard PIT3528C.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

Some owners may comment that the red radio theft LED does not flash after replacing and programming the radio. This may be due to the "enable counter" internal to the radio not being reset to 0 counts from the exchange center.

Recommendations / Instructions

During normal driving, the counter will count down to 0 after enough ignition cycles. If an owner is requesting the LED to operate immediately, the ignition key will need to be cycled up to 255 times on/off to clear the manufactures "enable counter". To count as a key cycle, the ignition must be left in the run and off positions for least 3 second each time. On then Off is considered to be 1 count.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

