



**NUMBER:** 09-005-15

**GROUP:** Engine

**DATE:** July 03, 2015

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 15-074. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.**

**SUBJECT:**

Right Side Engine Cover Missing With Shaker Package

**OVERVIEW:**

This bulletin involves installing the right side engine cover if missing.

**MODELS:**

2015 (LA) Dodge Challenger

**NOTE: This bulletin applies to vehicles within the following markets/countries: NAFTA.**

**NOTE: This bulletin applies to vehicles built on or after February 08, 2015 (MDH 0208XX) and on or before May 23, 2015 (MDH 0523XX) equipped with 6.4L Engine And Shaker Package (sales code AZS).**

**SYMPTOM/CONDITION:**

The customer may notice the right side engine cover is missing. Only the right side engine cover was missed during vehicle assembly, the left side of the engine does not get an engine cover and is not part of this service action.

**DIAGNOSIS:**

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. For all other customers that describe the symptom/condition listed above, perform the Repair Procedure.

**PARTS REQUIRED:**

Qty.	Part No.	Description
1	05281358AA	Cover, Wiring Protector, Right Side

**REPAIR PROCEDURE:**


1. Open the hood and inspect for the right side engine cover (Fig. 1).
2. Is the right side engine cover missing (1) or installed (2) (Fig. 1)?
  - a. Missing>>> Continue with the Repair Procedure [Step #3](#).
  - b. Installed>>> This bulletin has been completed, use LOP (09-47-01-94) to close the active RRT.



**Fig. 1 Right Side Engine Cover**

- 1 - Right Side Engine Cover Missing
- 2 - Right Side Engine Cover Installed

- 
3. Install the right side engine wiring protector cover from the PARTS REQUIRED section of this bulletin.
  4. Remove the oil level indicator (1) from the engine and place aside. Ensure not to contaminate the end of the oil level indicator (Fig. 2).
  5. Depress the two release tabs on the sides of the power distribution center cover (2) and place the cover aside (Fig. 2).

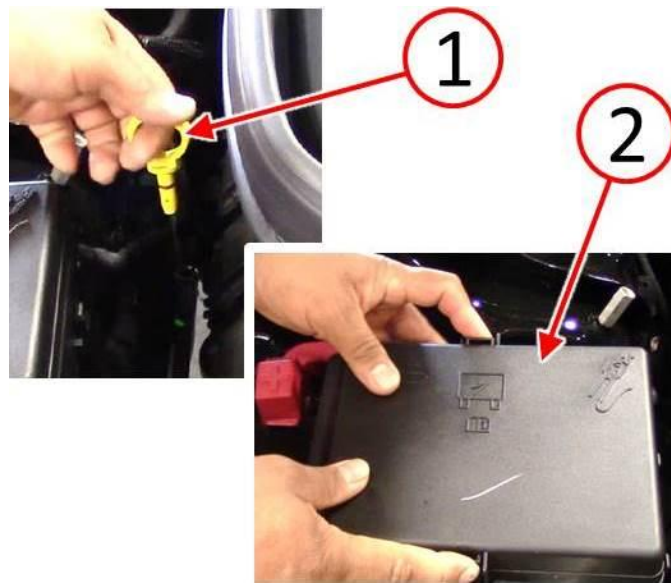

**Fig. 2 Oil Level Indicator - Power Distribution Center Cover**

- 1 - Oil Level Indicator
- 2 - Power Distribution Center Cover

---

6. Tilt the engine cover (1) and slide it under the air scoop base plate (Fig. 3).




**Fig. 3 Install Engine Cover**

- 1 - Engine Cover

---

7. Align the attachment sockets on the inside of the engine cover (1) with the attachment studs (2) on the engine head (Fig. 4).

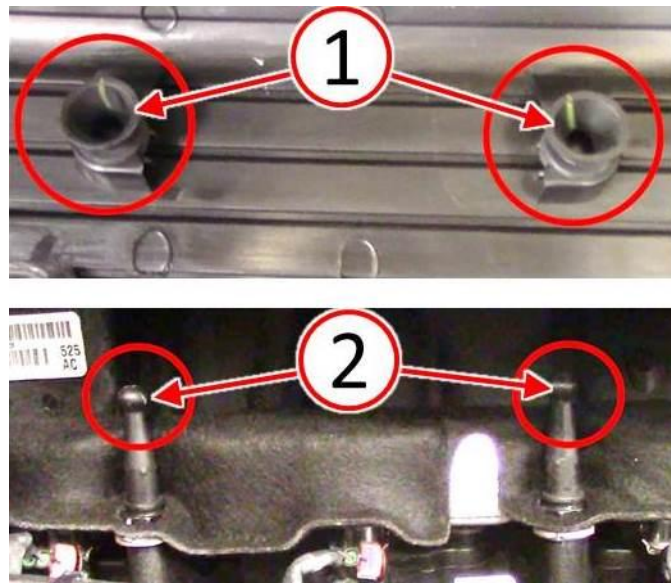

**Fig. 4 Engine Cover Attachment Feature**

- 1 - Attachment Sockets Inside Engine Cover
- 2 - Attachment Studs On Engine Head

- 
8. Apply firm hand pressure to the two attachment points until the engine cover (1) snaps in place (Fig. 5).




**Fig. 5 Secure Engine Cover**

- 1 - Engine Cover

- 
9. Install the cover (2) on the power distribution center (Fig. 6).

10. Install the oil level indicator (1) to the engine (Fig. 6).

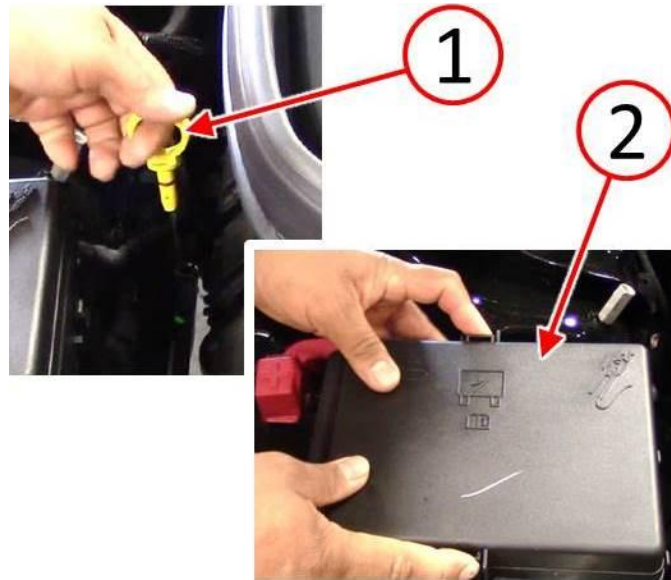

**Fig. 6 Oil Level Indicator - Power Distribution Center Cover**

- 1 - Oil Level Indicator
- 2 - Power Distribution Center Cover

---

**POLICY:**  
Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Skill Category	Amount
09-47-01-94	Inspect For Right Side Engine Cover (0 - Introduction)	1 - Engine Repair	0.2 Hrs.
09-47-01-95	Inspect And Install Right Side Engine Cover (0 - Introduction)	1 - Engine Repair	0.5 Hrs.

**FAILURE CODE:**

ZZ	Service Action
----	----------------