Measure no. US 62409104-02	Subject Turn indicators fail to light up with DWA alarm activation		
Status date (mm/dd/yy)	Status	Organization	
3/18/16	Accepted	US, MOT	
Date created (mm/dd/yy)	Created by	PQM Problem reference	
3/18/16	Simon Stammler		
Release date (mm/dd/yy)	Approved by	Dealer release	
		Allow automatic release	
Vehicles affected			
E series	Engine	Body	
K18/11 K19/11			
Production period (from/to)		Feedback (all cases relating to	
(mm/dd/yy)	Comment on production period	measure up to) (mm/dd/yy)	
1			

Complaint

When an alarm system [DWA basic low for C 650 sport (K18/11) and C 650 GT (K19/11)]

is activated, only the alarm tone sounds. Actuation of the turn indicator is missing.

Cause

Software error in the instrument cluster.

Measure

Program instrument cluster with integration level K001-16-03-500 or a higher version.

This measure is now available.

Complaint							
	Fault location	Fault type	Fault place	Fault conditions			
F	Visual / acoustic alarm	Failure		Permanent			
	output						
_							

Cause

F	#	Fault location	Fault type	Fault place		
	1	62/11 Instrument cluster	Software error			
		Repair Task	Special Clearance	Area		
			No	Electrics/Electronics		
Progman / DIS / ISTA / ISTA/P						
Sy	stem	I Contraction of the second	State	Version		

© 2002-2016 BMW OF NORTH AMERICA, LLC. ALL RIGHTS RESERVED.