



Preliminary Information

PIT5427B Service Messages on DIC and/or SES MIL

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2010 - 2017	All	All	All	All
GMC	Terrain	2010 - 2017	All	All	All	All

With Any Combination of DTCs C0196 C0186 C0287 C0710 C0045 C0050 C0800 U0073 U0074 U0077 U0125 U0126 U0100 U0101 U0121 U0415 U0432 U0121 U0140

Supersession Statement

This PI was superseded to update Model Years, and Condition Concern. Please discard PIT5427A.



The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

Some customers may comment on any one of the following conditions:

- SES Mil
- Service ABS
- Service Traction Control
- Service AWD (If equipped with RPO F46)
- Service Suspension Control
- Service Power Steering Message
- Any of the following DTCs: C0196 C0186 C0287 C0710 C0045 C0050 C0800 U0073 U0077 U0074 U0125 U0126 U0100 U0101 U0121 U0415 U0432 U0121 U0140

These concerns may be caused by corrosion in the X411 connector located under the rear of the vehicle, behind and to the left of the fuel tank.

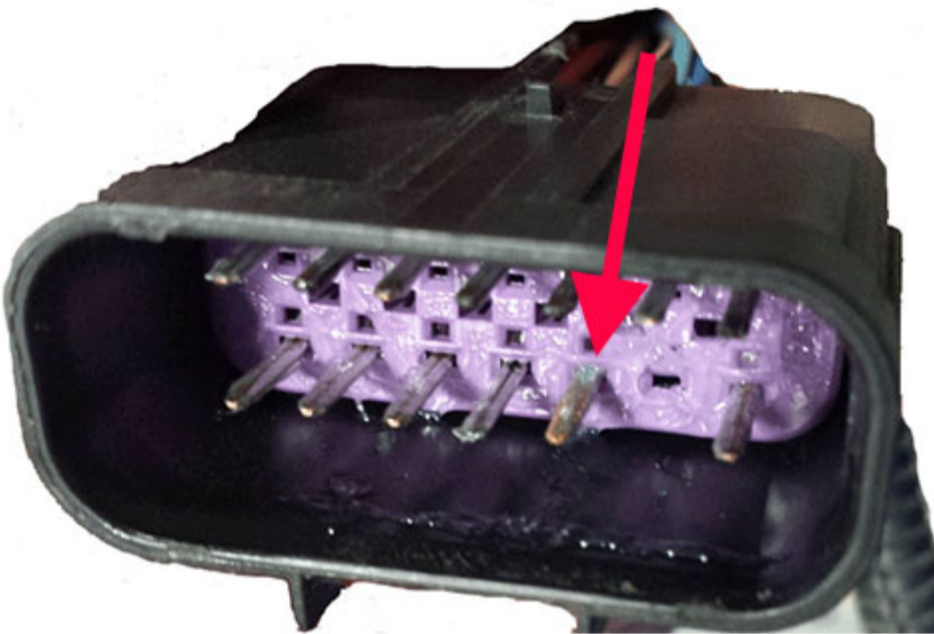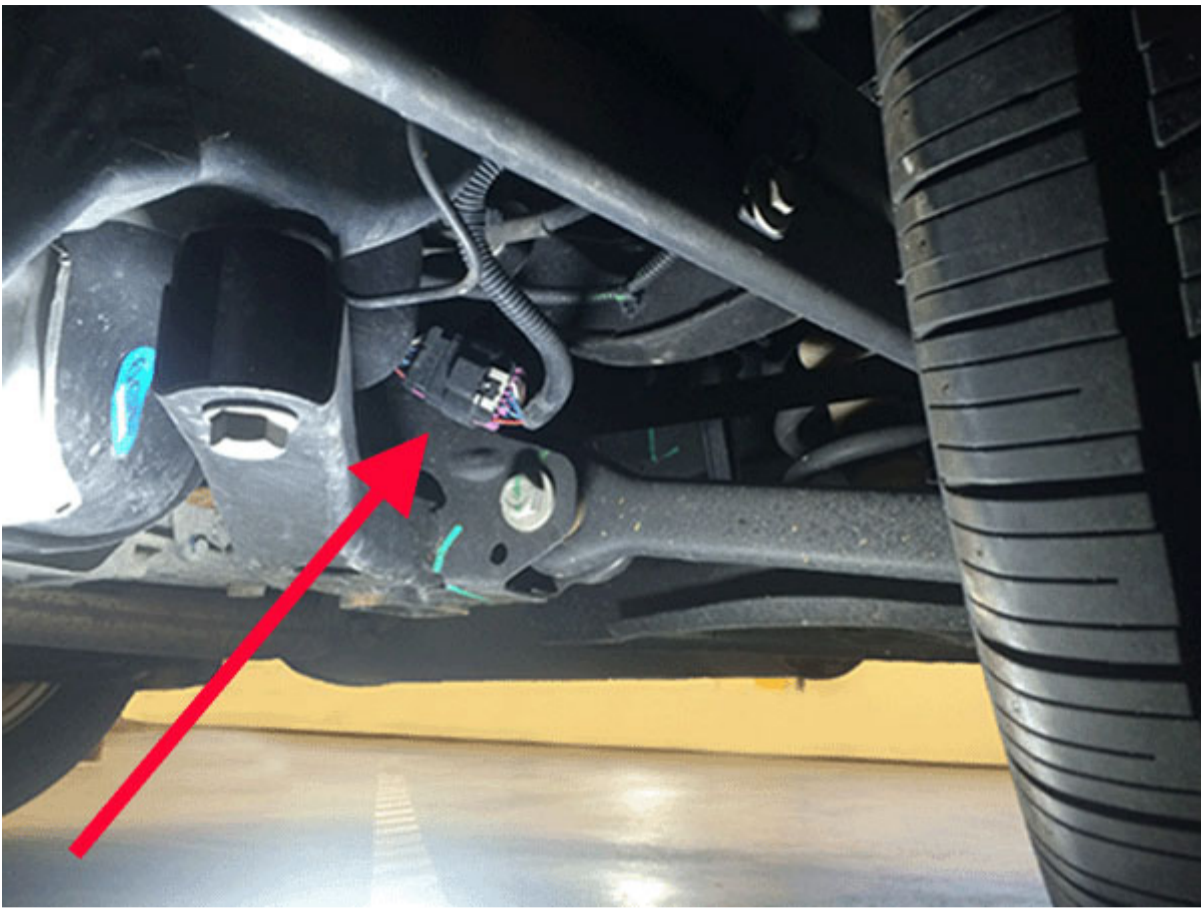

Recommendations / Instructions

To correct concern, please replace the appropriate terminals / connector at X411 as needed.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS