

Solution K53357197 Thursday, December 6, 2018 8:40:54 PM CET

Mack Models

Wack Woders	
Mack Model	GR-Granite, PI-Pinnacle, AN-Anthem
Volvo Models	
Volvo Model	VNR, VNX, VNL, VHD, VAH
Engine family	
Engine family	11L Engine, 13L Engine, MP7, MP8
Emission Standard	
Emission Standard	US17, 2018
** SOLUTION **	
Title	Dignostic Trouble Code (DTC, Fault Code) MID 140 PSID 210 FMI 12, Faulty Unit or Component Present On DTC Readout; Vehicle Operation Not Affected: No Physical Symptoms Or Warning Lights In Instrument Cluster - US17+OBD2016 Emissions, Model Year 2018
Cause	Note that this code does not cause any physical symptoms. There is no effect to vehicle operation and this code does not set any warning lights on the instrument cluster. It will only appear on a DTC readout if one is performed. Any physical symptoms or other fault codes present should be diagnosed as normal.
	Model year 2018 and 2019 vehicles may experience DTC MID 140 PSID 210 FMI 12 with a significant number of occurrences logged when a DTC readout is reviewed. It has been determined that the code is logged due to an Instrument Cluster Watchdog ECU timeout, a function embedded in the cluster's main software. It is also possible that a third party module may be causing communication interference on the J1587 Data Link.
	New software has been released to address this issue. With the new software, the cluster will have an extended window of time to power down last and prevent the code from setting.
Solution	For vehicles exhibiting this issue:
	1. Connect to the vehicle with Premium Tech Tool (PTT).

3. Select Information Display (MID 140) from the list of ECUs.

ogram tab in PTT.

4. Make sure Update Electronic Control Unit with latest software is selected. Click

2. Run Operation 1700-08-03-39 Program Electronic Control Unit, located under the Pr

the **Program** button in the lower right-hand corner.

5. Allow the operation to complete. Click **Exit** in the lower right-hand corner of the screen.

NOTE: This software update will also add a new function to the display. Following the update, the Brake Air Low icon will now appear in the information display when the correct conditions are met. The new icon can be seen below.

• This function is not related to the symptoms described for this Solution. Driver or customer reports of this new screen may be received after performing the update, and this note is meant to advise that this is a normal function of the new software.



Internal comments (BO)	Possible software issue. Waiting on Sigafoos for more details.
Solution visibility	Dealer distribution
Function(s)/compone	ent(s) affected
Function affected	MID 140 – IC04 / IC05, information display control unit
Function Group	
Function Group	381 combined instrument
Customer effect	
Main customer effect	fault code/display
Fault code(s)	
NA_MIDs	MID 140 PSID 210 FMI 12
Administration	
Author	RU2761V
Dealer ID	RU2761V
Last modified by	A241298

Creation date	26-10-2018 21:10
Date of last update	03-12-2018 17:12
Status	Under review
NA_Reviewer	RU2761V
Variantes Kola	
A5X - INTERIOR GENERATION	INT-GEN2