

# Latest Vehicle Concern Fixes



<h2>High Pressure Fuel Pump Failure P0087</h2>	<h2>All Vehicles Equipped with Diesel Engine (AJ20D &amp; 3.0L TDV6)</h2>
<p><b>Customer Voice:</b></p> <ul style="list-style-type: none"><li>• Check Engine Light illuminated, Restricted Performance Message on IPC</li></ul> <p><b>Technical Description:</b></p> <ul style="list-style-type: none"><li>• P0087-22/21 setting for fuel rail pressure sensor</li></ul> <p><b>Status:</b></p> <ul style="list-style-type: none"><li>• Under Investigation, but has been expanded to include AJ20D. Previously only thought to have affected RR &amp; RR Sport 3.0L TDV6.</li><li>• DTCs are for fuel rail pressure sensor. Diagnose as per TOPIx. Check fuel quality for any signs of contamination, include pictures in your TA submission. Hold onto any parts replaced for this concern</li><li>• <b>Care Point:</b> If diagnosis leads to the high pressure fuel pump, be mindful of how the gear is installed. When installed or torqued incorrectly, it can break and cause further damage. Follow TOPIx repair instructions for proper work instructions.</li></ul>	

