
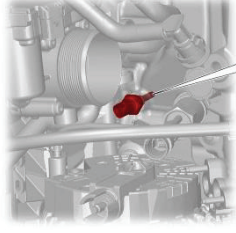

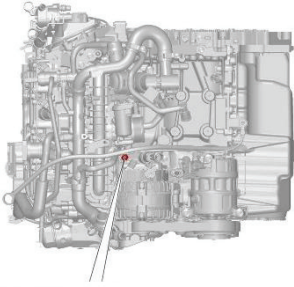


## Latest Vehicle Concern Fixes



| AJ20P Engine Block Coolant Temp Sensor                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 18 – 19MY vehicles equipped with AJ20P                                                                                                                                                                                                                                                                                                     |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <p><b><u>Customer Voice:</u></b></p> <ul style="list-style-type: none"><li>• The Check Engine Lamp is illuminated</li></ul> <p><b><u>Technical Description:</u></b></p> <ul style="list-style-type: none"><li>• DTC P01E6 (124439 Undefined) is stored in the PCM</li><li>• Electrical testing of the circuit between the sensor and PCM reveals no cause</li><li>• Electrical testing of the sensor identifies a short or open circuit in the sensor</li></ul> <p><b><u>Status:</u></b></p> <ul style="list-style-type: none"><li>• Ensure electrical testing of the sensor is performed with the body of the unit submerged in coolant (in the installed position)</li><li>• If replaced, raise an EPQR and include a name, email address and phone number of someone at the retailer who can serve as the point of contact for the shipping company to collect the original sensor for analysis</li></ul> |     |

