


## Latest Vehicle Concern Fixes



<h3>Hood Latch False Alarm Warning</h3>	<h3>E-PACE, XE, XF 18MY &amp; F-PACE 17-18MY</h3>
<p><b><u>Customer Voice:</u></b></p> <ul style="list-style-type: none"><li>• Customers may report that the vehicle alarm goes off intermittently without any noticeable trigger.</li></ul> <p><b><u>Technical Description:</u></b></p> <ul style="list-style-type: none"><li>• A test of alarm trigger history shows that the hood latch switch as the trigger for the alarm, even though the hood is securely latched and retained due to a quality concern of the micro switch within the hood latch assembly.</li></ul> <p><b><u>Status:</u></b></p> <ul style="list-style-type: none"><li>• A revised hood latch has been developed to address this concern with a more robust micro switch to prevent false activations.</li><li>• Service Action H164 will be published to proactively resolve this concern on affected Jaguar models.</li><li>• Service Action N258 has already been published for affected Land Rover model variants.</li></ul>	 <p>E230001</p>

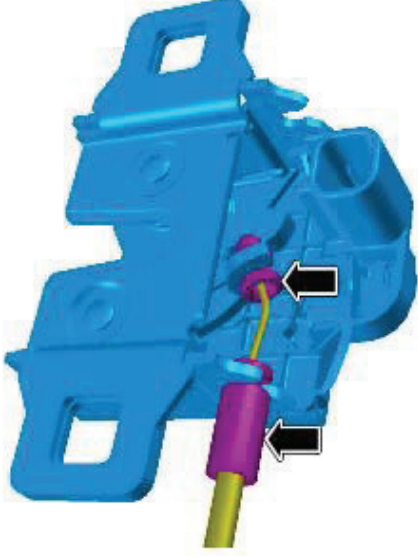