


Latest Vehicle Concern Fixes



Roof Opening Panel – Lower Level Service Repair	F-PACE
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none">• Customers may report that the roof opening panel mechanism has become jammed or does not tilt up properly. <p><u>Technical Description:</u></p> <ul style="list-style-type: none">• This may be caused by wear or damage to the opening panel guide rails. <p><u>Status:</u></p> <ul style="list-style-type: none">• Lower level service parts have been made available to replace the guide rails without the need to replace the complete panoramic roof assembly.• Procedures for replacing the guide rails has been added to the Workshop Manual. Please refer to Topix, section 501-17 Roof Opening Panel, Removal and Installation - Roof Opening Panel Guide Rails• Jaguar F-Pace Service Part Numbers:<ul style="list-style-type: none">• Left Hand Guide Rail = T4A33021• Right Hand Guide Rail = T4A33020	 A technical diagram showing the interior of a vehicle with the roof opening panel highlighted in blue. Two arrows point to the guide rails on either side of the panel's track.

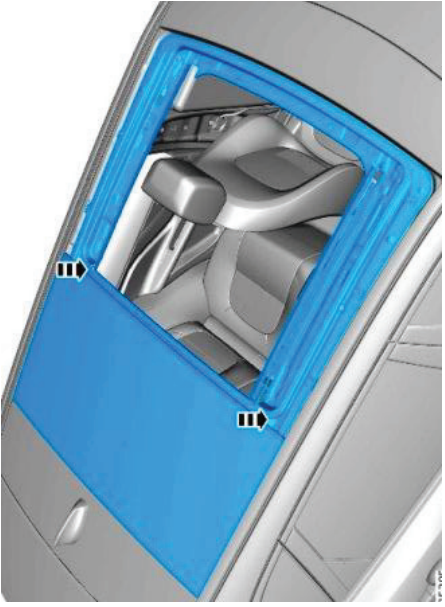