

**Symptom in Vehicle Interior - Front "Real Top View" Camera Display in PCM is Milky/Cloudy (I-no. KA6): Replacing front wire harness (SY 143/18)**

Vehicle Type: **Cayenne (9YA)**

Model Year: **As of 2018 up to 2019**

Equipment: **Real Top View (4-camera system) (I-no. KA6)**

Subject: **Front wire harness**

Symptom: The front "Real Top View" camera display in the PCM is milky/cloudy although the camera lens is clean and dry.

Cause: Moisture can seep into the plug connection on the front wire harness.

Remedial Action: In the event of a customer complaint, replace the existing wire harness with a new wire harness with a modified sealing concept **and** replace the front camera, see ⇒ *Workshop Manual '971519 Removing and installing front wire harness'* and ⇒ *Workshop Manual '916919 Removing and installing front camera'*.

Date of Introduction: A wire harness with a modified sealing concept has been used during production since March 21, 2018 or as of chassis number 9YZ KDA 005 74.

Parts Info:



**Information**

**The following points must be observed in relation to the relevant vehicle (depending on equipment):**

- **Particular/modified components are required** in order to **correct the problem**.
- **Depending on vehicle equipment**, the part number of the modified component will be different. The required part number can be found in the **PET** (Porsche Spare Parts Catalog).
- **The PET must also be used to check whether other components are required for carrying out the repairs completely.**

See PET                      Wire harness for front bumper  
**958.980.546.00**            ⇒ Camera (Real Top View)

Invoicing: The work involved is invoiced under the labor operation:

APOS	Labor operation	I No.
97151900	Removing and installing front wire harness	
91691900	Removing and installing front camera	

For invoicing and documentation using PQIS, enter the following coding:

Location (FES5)	91690	Front camera
Damage type (SA4)	5011	Water leak

References: ⇒ *Workshop Manual '971519 Removing and installing front wire harness'*  
 ⇒ *Workshop Manual '916919 Removing and installing front camera'*

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2018 Porsche Cars North America, Inc.