



# Technical Service Bulletin

---

<b>Technical Service Bulletin:</b> TSB190014	<b>Released Date:</b> 28-Jan-2019
<b>Damaged Flywheel Housing: Nova Bus™ Chassis</b>	

## Damaged Flywheel Housing: Nova Bus™ Chassis

### Warranty Statement

---

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

### Contents

---

#### Product Affected

Engines:

- ISL9 CM2350 L101
- L9 CM2350 L123B
- ISL G CM2180
- L9N CM2380 L124B

Chassis:

- Nova Bus™

Model:

- Non Articulated with VOITH D864.6-40' transmission

#### Issue

Symptom:


- Visible crack and/or damage of the flywheel housing

Root Cause:

- Overloading of the flywheel housing.

**Verification**

Visible crack and/or damage of the flywheel housing at or near the flywheel housing mounting pad location. See Figure 1 below.

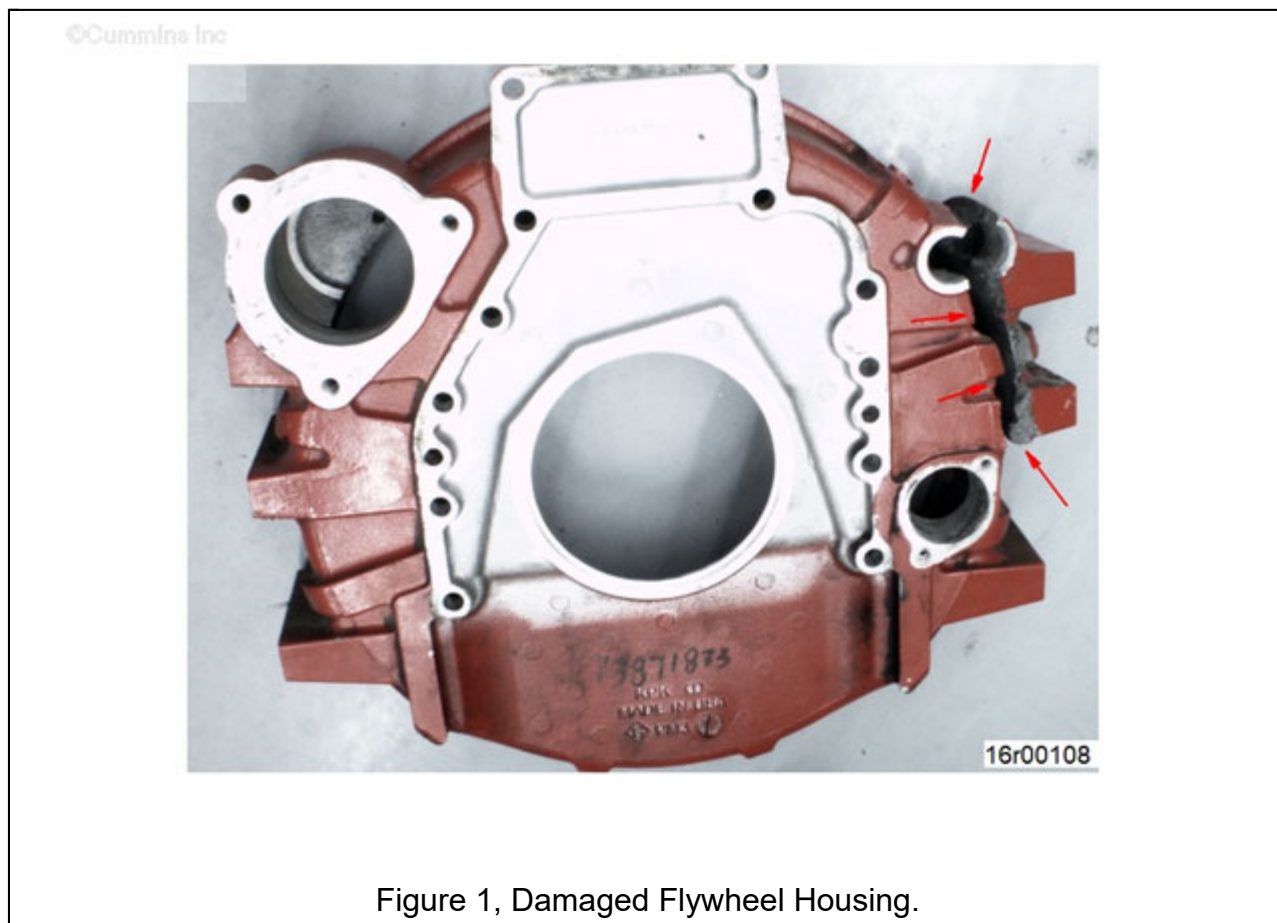

**Resolution**

Replace existing flywheel housing with new Part Number 5477583.

**Service Parts Availability**

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
HOUSING, FLYWHEEL	5316752	No	No	5477583

**Publications Affected**

<b>Table 3, Publications Affected</b>					
<b>Manual Type</b>	<b>Engine</b>	<b>Bulletin Number</b>	<b>Procedure Title</b>	<b>Procedure</b>	<b>Section</b>
Service Manual	ISL CM2350	4367223	Flywheel Housing	Refer to Procedure 016-006	16
	L9 CM2350	5411267			
	ISL G CM2180	4021649			
	L9N CM2380	5467492			

## Document History

<b>Date</b>	<b>Details</b>
2019-1-23	Module Created

---

**Last Modified: 28-Jan-2019**

---