



## Preliminary Information

### PIP5521A Malfunction Indicator Lamp MIL On DTC P0871 Or P2714 Set In The TCM

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Spark	2014 - 2019	All	All	All	M4M MR8

Involved Region or Country	North America
Condition	Some customers may comment on the operation or performance of the CVT7 transmission and/or the SES light is illuminated.
Cause	Technicians may find codes P0871 or P2714 set in the TCM.

#### Correction:

If codes P0871 or P2714 is found to be set in the TCM please clear the codes and road test the vehicle.

If the codes do not reset no repairs should be performed and the vehicle can be returned to the customer.

If the codes reset replace the transmission fluid pressure switch following SI document 5151272.

If the vehicle is released to the customer because the codes did not reset during the road test and later returns with the same concern and codes P0871 or P2714 have reset replace the transmission fluid pressure switch following SI document 5151272.

At this time the pressure switch must be ordered from the WPC using the following form and ordering part WPC 833

**This P/I will be updated or advanced to a TSB, if needed.**

To ensure full page print do not adjust size, select magnifying glass to enlarge then print. (Text in SI to assist in printing)

## WPC Parts Request Form

This form ONLY for U.S. & Canada Dealers. Export markets & Mexico Dealers must contact their regional Technical Assistance Center for assistance.

Return form to Warranty Parts Center by E-Mail:

[warrantypartscenterusa@gm.com](mailto:warrantypartscenterusa@gm.com)

or WPC Fax #: 248-371-0192 Attn: Temporary Service Parts

Part Being Requested: WPC #

Dealer BAC (U.S.) / Dealer Code (Canada):

Dealer Name:

Dealer Address:

Dealer Contact Person:

Dealer Phone Number:

Repair Order Number:

Vehicle VIN:

If you do not receive the part within 2 business days after emailing or faxing your part request to the Warranty Parts Center, please call Customer Assistance at 248-371-9901.

To ensure full page print do not adjust size, select magnifying glass to enlarge then print. (Text in SI to assist in printing)

### Parts Information

Description	Part Number	QTY
Fluid Pressure Switch	WPC833	1

### Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
8462370	Transmission Fluid Pressure Switch Replacement.	Use Published Labor Time.

### Version History

Version	2
---------	---

Modified

9/14/2017 - Created

02/08/2019 - Updated to recommend transmission fluid pressure switch replacement instead of replacing the valve body and update model years.



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.