



Bulletin No.: PIP4607A
Published date: 12/4/2018

Preliminary Information

PIP4607A (Hybrid) Vehicle May Not Start or Intermittent Start Due To Poor Crimp on Terminal

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Tahoe	2008	All	8R217000	LFA	M99
GMC	Yukon	2008	All	8R217000	LFA	M99

Supersession Statement

This PI was superseded to update Subject. Please discard PIP4607.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

Customer may comment that the vehicle will not start or the engine will not crank or cranks intermittently, technicians may find any one of or a combination of DTC's P0A45, P0C61, P0A46, P1B04.

Recommendations / Instructions

The concern may be caused by a poor crimp on terminal 20 at the transmission 24 way pass through connector X176, reference SI document #1985309 item #3 for connector location. Replace the transmission internal harness if the VIN is prior to 8R217000.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS