Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject:
WHINING NOISE FROM AUTOMATIC TRANSAXLE

Bulletin No.: 05-002/19

Last Issued: 03/27/2019

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in red text.

| Previous TSBs: | Issued Dates: |
|----------------|---------------------------------|
| 05-008/16 | 12/07/16 |
| 05-005/15 | 11/17/15 and 04/08/15 |
| 05-004/14 | 05/05/14, 03/19/14 and 03/05/14 |

APPLICABLE MODEL(S)/VINS

- 2012-2013 Mazda3 (SKYACTIV A/T)
- 2014-2018 Mazda3 (SKYACTIV A/T)
- 2013-2016 CX-5 (SKYACTIV A/T)
- 2017-2019 CX-5 (SKYACTIV A/T except 2.5T engine) with VINS lower than JM3KF*****515940 (produced before November 1, 2018)
- 2014-2017 Mazda6 (SKYACTIV A/T)
- 2018 Mazda6 (SKYACTIV A/T except 2.5T engine) with VINS lower than JM1GL******330038 (produced before November 1, 2018)
- 2016-2019 CX-3 (SKYACTIV A/T) with VINS lower than JM1DK*****427352 (produced before October 31, 2018)

DESCRIPTION

Some customers may complain of a whining noise from the automatic transaxle when driving at 10 mph and above. The noise:


- Depends on the vehicle's speed only (the more speed, the more noise)
- Occurs with all types of driving (acceleration, deceleration, steady speed)
- Does not depend on rpm, gear, or ATF temperature

Page 1 of 9

This is caused by a damaged bearing in the transaxle due to improper configuration of the transaxle case. A modification has now been implemented on automatic transaxles with the following serial numbers:

- 7TN0820364 and higher (CX-3) / 8TN1090104 and higher (except CX-3)
- 8TR1008883 and higher
- 8TD1003276 and higher
- 8T50331192 and higher (CX-3) / 8T50329705 and higher (except CX-3).

The serial number can be found on top of the transaxle case near the manual shaft lever.

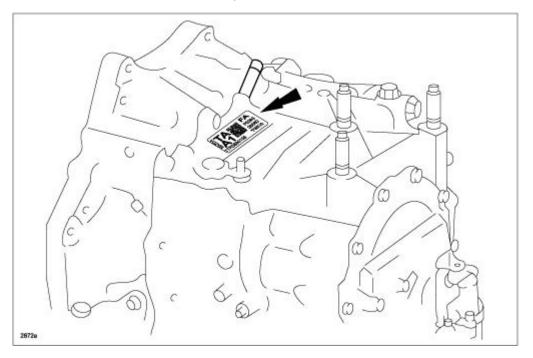

The following table shows how to decifer the serial number. Example 8TN1090104 means Oct., 2018 production.

| 8 | TN | 10 | 90104 |
|--------|-----------------|-------------|---------------|
| | Production line | _ | Serial Number |
| 3=2013 | TN | 01 / 51=Jan | |
| | TR | | XXXXX |
| | TD | | ^^^^ |
| | T5 | | |
| 4=2014 | | 02 / 52=Feb | |
| ••• | | ••• | |
| 6=2016 | | 10 / 60=Oct | |
| 7=2017 | | 11 / 61=Nov | |
| 8=2018 | | 12 / 62=Dec | |

Customers having this concern should have their vehicle repaired using the following repair procedure.

Page 2 of 9

| Bulletin No.: 05-002/19 | Last Issued: 03/27/2019 |
|--------------------------------|-------------------------|
| | |

REPAIR PROCEDURE

- 1. Verify customer concern.
- 2. Replace the 6AT assembly with a new one according to MGSS online instructions. **NOTE:** MASH authorization IS required for A/T replacement on 2017 and later models and IS NOT required for 2016 and earlier models still under warranty.
- 2012-2013 Mazda3: (AUTOMATIC TRANSAXLE REMOVAL/INSTALLATION)
- 2014-2018 Mazda3: (AUTOMATIC TRANSAXLE REMOVAL/INSTALLATION)
- 2014-2017 Mazda6: (AUTOMATIC TRANSAXLE REMOVAL/INSTALLATION)
- 2018 Mazda6: (AUTOMATIC TRANSAXLE REMOVAL/INSTALLATION)
- 2013-2016 CX-5: (AUTOMATIC TRANSAXLE REMOVAL/INSTALLATION)
- 2017-2019 CX-5: (AUTOMATIC TRANSAXLE REMOVAL/INSTALLATION)
- 2016-2019 CX-3: (AUTOMATIC TRANSAXLE REMOVAL/INSTALLATION)
- 3. Verify repair.

PARTS INFORMATION

| Description | Vehicle | Engine | Part Number | Qty. | Notes |
|-----------------------|-----------------------|--------|-------------|------------|-----------------------|
| 6AT SKYACTIV Assembly | 2012-13 Mazda3 | 2.0L | FWK1-03-000 | 1 | |
| | 2013 CX-5 (FWD) | 2.0L | FWL1-03-000 | | -9/6/2012 |
| | | | | | w/out kickdown switch |
| | 2013 CX-5 (AWD) | 2.0L | FW7A-03-000 | | |
| | 2013 CX-5 (FWD) | 2.0L | FWLC-03-000 | | 9/7/12-11/19/12 |
| | | | | | w/ kickdown switch |
| | 2013 CX-5 (AWD) | 2.0L | FW78-03-000 | | |
| | 2014 CX-5 (FWD) | 2.0L | FWL7-03-000 | | |
| | 2014 CX-5 (AWD) | 2.0L | FW7F-03-000 | | |
| | 2014 CX-5 (FWD) | 2.5L | FWH4-03-000 | | |
| | 2014 CX-5 (AWD) | 2.5L | FW7L-03-000 | | |
| | 2014 Mazda6 | 2.5L | FWH3-03-000 | | w/out i-ELOOP |
| | | | FWH9-03-000 | w/ i-ELOOP | |
| | 2014 Mazda3 (VIN JM1) | 2.0L | FWB2-03-000 | | |
| | 2014 Mazda3 (VIN JM1) | 2.5L | FWH1-03-000 | | |
| | 2014 Mazda3 (VIN 3MZ) | 2.0L | FWT6-03-000 | | |
| | Others | | FW**-03-000 | | Refer to GEPC |

NOTE: MASH authorization IS required for A/T replacement on 2017 and later models and IS NOT required for 2016 and earlier models still under warranty.

Page 3 of 9

| Bulletin No.: 05-002/19 | Last Issued: 03/27/2019 |
|-------------------------|-------------------------|
| | |

Non-reusable Parts Mazda3 (BL)

| Part Number | Part Name | Qty | Notes |
|-----------------|-----------|-----|---|
| T060-26-169A | Pin, Snap | 2 | For Tie-rod End |
| D651-33-042A | Nut | 2 | For Drive Shaft |
| G054-25-421 | Clip | 1 | For Drive Shaft |
| FU31-19-423 | Plug | 1 | Pressure Detection Square Head Plug (for line pressure check) |
| L2Y1-33-247 | Grease | 1 | For Knuckle (one tube will do 10 vehicles) |
| 0000-FZ-113E-01 | ATF-FZ | 9 | 8.2 qt (7.8 L, 6.9 lmp qt) max. |

Mazda3 (BM/BN)

| Part Number | Part Name | Qty | Notes |
|-----------------|-------------|-----|---|
| B455-32-099B | Bolt, Shaft | 1 | Joint Bolt A (Lower), Intermediate Shaft |
| T060-26-169A | Pin, Snap | 2 | For Tie-rod End |
| D651-33-042A | Nut | 2 | For Drive Shaft |
| G054-25-421 | Clip | 1 | For Drive Shaft (2.0L) |
| H010-25-421 | Clip | 1 | For Drive Shaft (2.5L) |
| 9YA2-80-603A | Bolt | 4 | Set Bolt for PCM Cover (2.0L/2.5L, with set bolt) |
| FU31-19-423 | Plug | 1 | Pressure Detection Square Head Plug (for line pressure check) |
| L2Y1-33-247 | Grease | 1 | For Knuckle (one tube will do 10 vehicles) |
| 0000-FZ-113E-01 | ATF-FZ | 9 | 8.2 qt (7.8 L, 6.9 lmp qt) max. |

Mazda6 (GJ/GL)

| Part Number | Part Name | Qty | Notes |
|---------------------|-------------------------|-----|---|
| B455-32-099B | Bolt, Shaft | 1 | Joint Bolt A (Lower), Intermediate shaft |
| PYFB-15-169 | Gasket, Water Outlet | 1 | For Lower radiator Hose Component (GL with coolant control valve) |
| T060-26-169A | Pin, Snap | 2 | For Tie-rod End |
| D651-33-042A | Nut | 2 | For Drive Shaft |
| H010-25-421A | Clip | 1 | For Drive Shaft |
| 9YA2-80-603A | Bolt | 2 | Set Bolt for PCM Cover (with set bolt) |
| FU31-19-423 | Plug | 1 | Pressure Detection Square Head Plug (for line pressure check) |
| L2Y1-33-247 | Grease | 1 | For Knuckle (one tube will do 10 vehicles) |
| 0000-FZ-113E- 01 | ATF-FZ | 9 | 8.2 qt (7.8 L, 6.9 lmp qt) max. |

Page 4 of 9

CX-3 (DK)

| Part Number | Part Name | Qty | Notes |
|---------------------|-------------------------|-----|--|
| B455-32-099B | Bolt, Shaft | 1 | Joint Bolt A (Lower), Intermediate Shaft |
| PYFB-15-169 | Gasket, Water Outlet | 1 | For Lower Radiator Hose Component (with coolant control valve) |
| T060-26-169A | Pin, Snap | 2 | For Tie-rod End |
| D651-33-042A | Nut | 2 | For Drive Shaft |
| H010-25-421A | Clip | 1 | For Drive Shaft |
| CN01-27-397 | Seal, Oil | 1 | Transfer oil seal (RH) No.1 (AWD) |
| KN01-27-398 | Seal, Oil | 1 | Transfer oil seal (RH) No.3 (AWD) |
| 9YA2-80-603A | Bolt | 4 | Set Bolt for PCM Cover (2.0L with set bolt) |
| FU31-19-423 | Plug | 1 | Pressure Detection Square Head Plug (for line pressure check) |
| L2Y1-33-247 | Grease | 1 | For Knuckle (one tube for more than ten vehicles) |
| 0000-FZ-113E- 01 | ATF-FZ | 9 | 8.2 qt (7.8 L, 6.9 lmp qt) max. |

CX-5 (KE/KF)


| Part Number | Part Name | Qty | Notes |
|---------------------|-------------------------|-----|---|
| B455-32-099B | Bolt, Shaft | 1 | Joint Bolt A (Lower), Intermediate Shaft |
| PYFB-15-169 | Gasket, Water Outlet | | For Lower Radiator Hose Component (KF with coolant control valve) |
| T060-26-169A | Pin, Snap | 2 | For Tie-rod End |
| D651-33-042A | Nut | 2 | For Drive Shaft |
| H010-25-421A | Clip | 1 | For Drive Shaft |
| CN01-27-397 | Seal, Oil | 1 | Transfer Oil Seal (RH) No.1 (AWD) |
| KN01-27-398 | Seal, Oil | 1 | Transfer Oil Seal (RH) No.3 (AWD) |
| PE17-13-460 | Gasket | 1 | For Exhaust Manifold (2.0L AWD) |
| PY01-13-460 | Gasket | 1 | For Exhaust Manifold (2.5L AWD) |
| PE23-40-305 | Gasket | 1 | For TWC (AWD) |
| 9994-61-000 | Nut | 2 | For TWC (AWD) |
| 9YA2-80-603A | Bolt | 2 | Set Bolt for PCM Cover (with set bolt) |
| FU31-19-423 | Plug | 1 | Pressure Detection Square Head Plug (for line pressure check) |
| L2Y1-33-247 | Grease | 1 | For Knuckle (one tube will do 10 vehicles) |
| 0000-FZ-113E- 01 | ATF-FZ | 9 | 8.2 qt (7.8 L, 6.9 lmp qt) max. |

Page **5** of **9**

• Joint Bolt A for Intermediate Shaft



• Lower Radiator Hose Component (DK/GL/KF with coolant control valve)

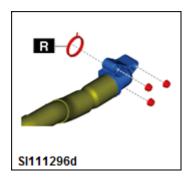


Page 6 of 9


Last Issued: 03/27/2019

Bulletin No.: 05-002/19

- Snap Pin for Tie-rod End
- Lock Nut for Driveshaft
- Clip for Drive Shaft (LH)
- Grease (L2Y1-33-247) for knuckle

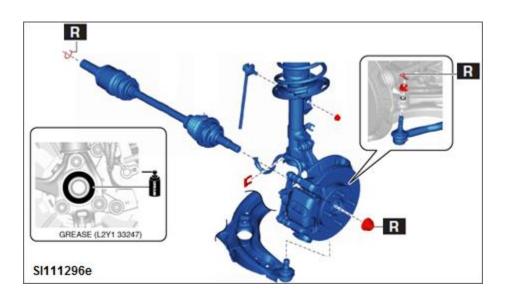


Transfer Oil Seals (RH/AWD)

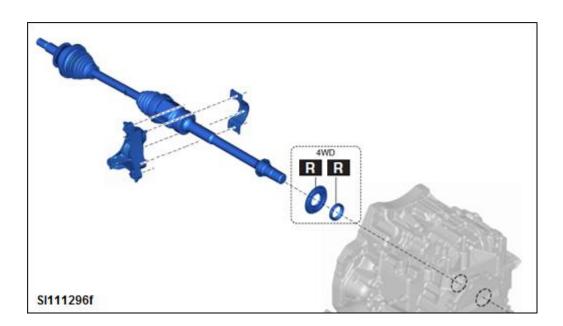


Page **7** of **9**


Bulletin No.: 05-002/19

- Gasket for Exhaust Manifold (AWD)
- Gasket for TWC (AWD)
- Nut for TWC (AWD)

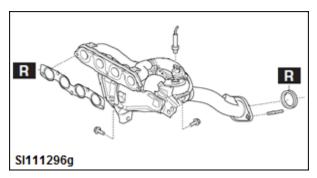

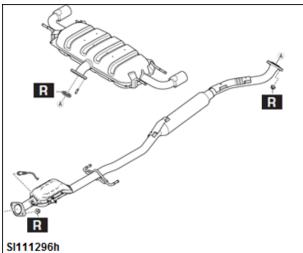

• Pressure Detection Square Head Plug

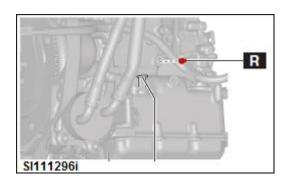

Page **8** of **9**

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's Powertrain Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

| Warranty Type | А |
|---------------------------------|--|
| Symptom Code | 82 |
| Damage Code | 9G |
| Part Number Main Cause | ****-03-000* |
| Quantity | 1 |
| Operation Number / Labor Hours: | XXR1XBRX / 4.6 Hrs. (2012-2018 Mazda3) |
| | XXR1XCRX / 4.6 Hrs. (2014-2017 Mazda6) |
| | XXR1XDRX / 4.9 Hrs. (2018 Mazda6) |
| | XXR1XFRX / 4.8 Hrs. (2016-2019 CX-3 FWD) |
| | XXR1XHRX / 6.8 Hrs. (2016-2018 CX-3 AWD) |
| | XXR1XJRX / 7.0 Hrs. (2019 CX-3 AWD) |
| | XXR1XMRX / 4.9 Hrs. (2013-2016 CX-5 FWD) |
| | XXR1XNRX / 6.9 Hrs. (2013-2016 CX-5 AWD) |
| | XXR1XPRX / 5.2 Hrs. (2017-2019 CX-5 FWD) |
| | XXR1XRRX / 7.1 Hrs. (2017-2018 CX-5 AWD) |
| | XXR1XSRX / 7.5 Hrs. (2019 CX-5 AWD) |
| | Front Wheel Alignment Check and Adjust |
| | - using wired type 4-wheel alignment tester |
| | XXR1SAAX / 1.3 Hrs. |
| | - using wireless type 4-wheel alignment tester |
| | XXR1SBAX / 0.8 Hrs. |

Page **9** of **9**