

**19-2012**08 February  
2019**TECHNICAL SERVICE BULLETIN****3.2L - Illuminated Malfunction Indicator Lamp (MIL) - Diagnostic Trouble Codes (DTCs) P24A0 And/Or P26A0**

This bulletin supersedes 18-2308 . Reason for update: New Part/Procedure For Same Condition

**Model:**

<b>Ford</b> 2015 Transit
-----------------------------

**Summary**

This article supersedes TSB 18-2308 to update the Service Procedure and Parts List.

**Issue:** Some 2015 Transit vehicles equipped with a 3.2L engine may exhibit an illuminated MIL with DTCs P24A0 and/or P26A0 stored in the powertrain control module (PCM).**Action:** Follow the Service Procedure steps to correct the condition.**Parts**

Part Number	Description	Quantity
CK4Z-9B593-B	Fuel Vaporizer System Glow Plug	1
F2UZ-14526-J	Mini Fuse (3 Amp)	1
F2UZ-14526-P	Mini Fuse (20 Amp)	1

**Warranty Status:** Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.**Labor Times**

Description	Operation No.	Time
2015 Transit 3.2L: Retrieve DTCs And Replace The Fuel Vaporizer System Glow Plug Includes Time To Check And Replace Fuses If Necessary (Do Not Use With Any Other Labor Operations)	192012A	0.7 Hrs.

**Repair/Claim Coding**

Causal Part:	9B593
Condition Code:	42

**Tool List**

Drive	Tool Name
1/4"	Power Tool
1/4"	Ratchet
1/4"	Torque Wrench
1/4"	8 mm Deep Socket
1/4"	10 mm Deep Socket
3/8"	Power Tool
3/8"	Ratchet
3/8"	Torque Wrench
3/8"	19 mm Crows Foot Socket

Drive	Tool Name
	Pocket Screwdriver

## Service Procedure

1. Using the appropriate Ford scan tool or equivalent, retrieve DTCs. Are P24A0 and/or P26A0 the only DTCs stored in the PCM?
  - (1). Yes - proceed to Step 2.
  - (2). No - this article does not apply. Refer to the Powertrain Controls/Emissions Diagnosis (PC/ED) Manual for normal diagnostics.
2. Replace the fuel vaporizer system glow plug. Refer to Workshop Manual (WSM) Section 309-00C.
3. Inspect battery junction box (BJB) fuses F5 (3A) and F12 (20A) and replace if open.

---

© 2019 Ford Motor Company  
All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.