VOLVO CAR SERVICE AND PARTS BUSINESS



Technical Journal

TITLE: Noise from deco door panel when playing music

REF NO:	ISSUING DEPARTMENT:		ARKET:
TJ 33228.1.0	Technical Service		s and Canada
3 US 7	PARTNER:	ISSUE DATE:	STATUS DATE:
	2510 Volvo Car USA	2018-03-08	2018-03-13
FUNC GROUP: 8511	FUNC DESC: Door upholstery	Page ⁻	1 of 11

"Right first time in Time"

Attachment

File Name	File Size
TJ 33228.pdf	3.4300 MB

Vehicle Type

Туре	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
246						2018-9999		0000390-0999999	201717-999952

CSC Customer Symptom Codes

Code	Description
G8	Doors/Squeak/rattle/Front side door

VST Operation Number

VST Operation Number	Description
98703-2	Decor panel front door x2 adjust acc. to TJ33228

DTC Diagnostic Trouble Codes

Text

Produced in the USA and available as an electronic document. Hard copy documents are printed in USA on recycled paper containing a minimum of 50% wastepaper and 10% post-consumer waste. © 2018 VOLVO CAR USA, LLC

Technical Journal 33228.1.0



DESCRIPTION:

If a buzzing noise is heard from the upper part of door panel in front doors when playing music, follow the method under Service.

SERVICE:

For cars with Premium sound: use foam p/n 3540111, for other cars use tape p/n 30788314 Follow instructions in attachment TJ 33228.pdf.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 8511.

To view TJ attachment continue to next page. This TJ has one attachment.

VOINVO			
	Volvo Car Customer Service	TJ Instruction VCC	C-508722-2
Title	Decor panel, door	Page	1(9)
Action	Product fix	Operation number:	98703-2
Action		Operation number:	98703-2

Issue	Date	Reason
1	2017-12	First issue
2	2018-02	Materials list change

Affected vehicles


Model yearModel2018XC60 (18-)


Materials				
Materials	Qty.	Part No.	Notes	
Anti-squeak tape	0.01	30788314	High Performance Soundsystem;	
Foam plastic	2.0	3540111	Premium Soundsystem;	
Clip	2.0	31699825		

Equipment				
Designation	Part No.			
Electrician's screwdriver				
Interior trim remover				

Removal

Note! Removal steps in this procedure may contain installation details.

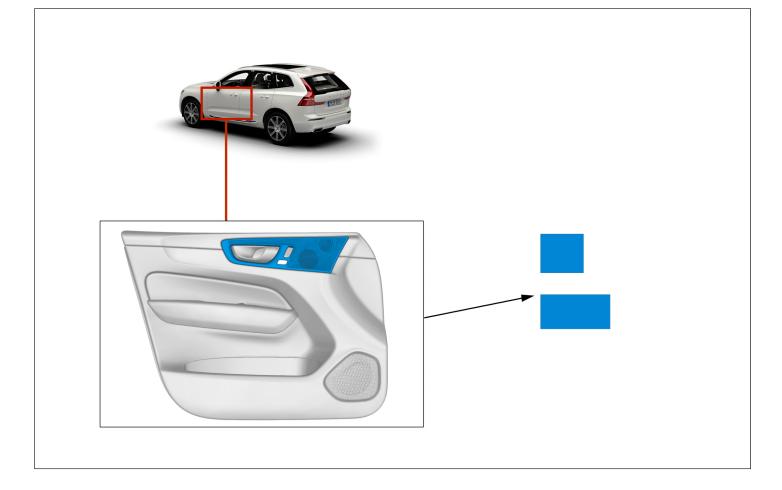


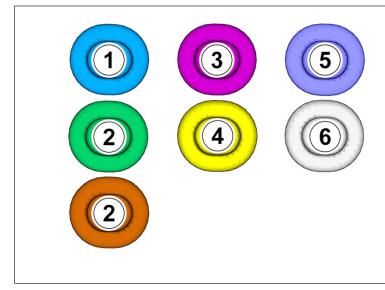

- 1 . Used for focused component, the component with which you will do something.
- 2. Used as extra colors when you need to show or differentiate additional parts.
- 3 . Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5 . Used for standard tools and special tools.
- 6 . Used as background color for vehicle components.


Applies to front door

Remove window control switch front, refer to: Removal, replacement and installation 3 - Electrical system 36 - Other electrical equipment 364 - electrical item

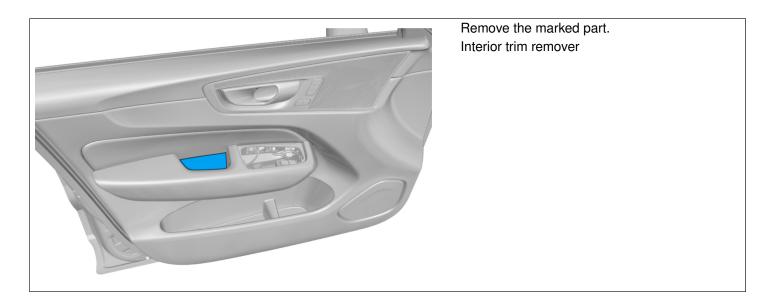




TJ Instruction VCC-508722-2

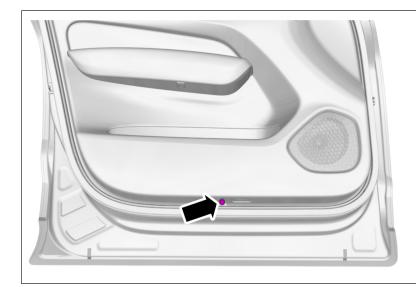

Torque:


M5,5 Nm


Remove the screw.

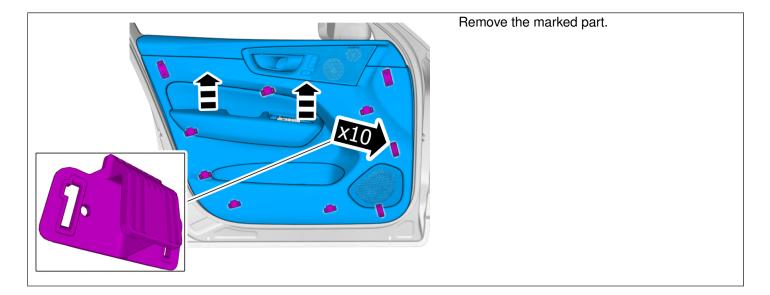

TJ Instruction VCC-508722-2

Page 5 (9)

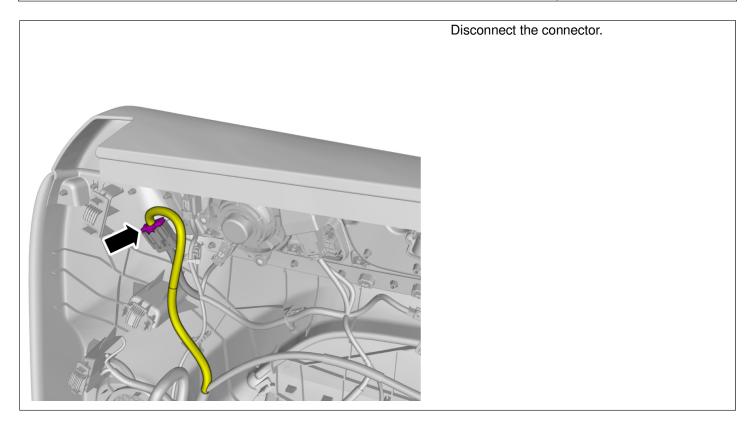

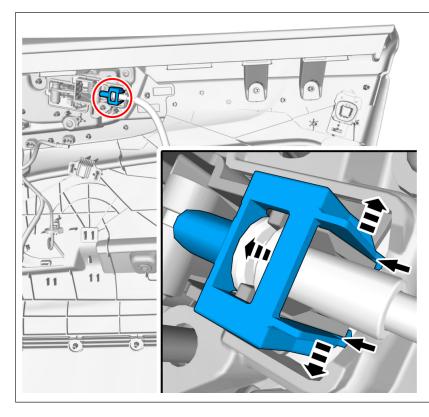


Release the catches.


Use: Electrician's screwdriver

Remove the marked part. The part is not to be reused.


Make sure to replace the marked component with a new.


Page 6 (9)

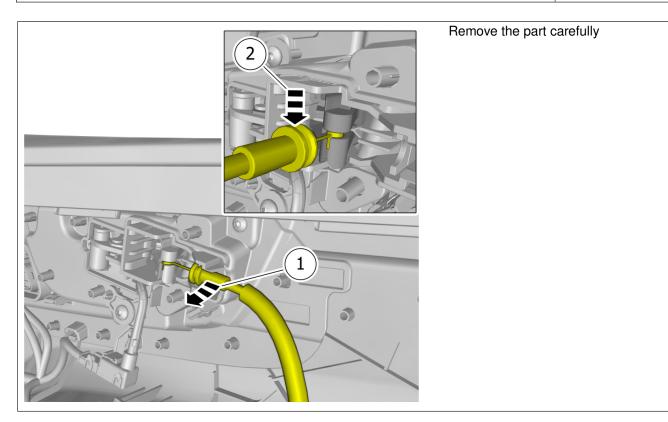


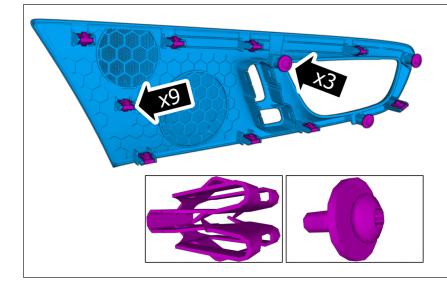


Note! The graphic shows the back of the component before removal.

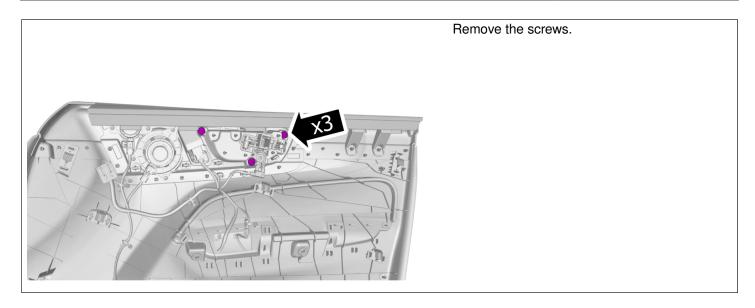

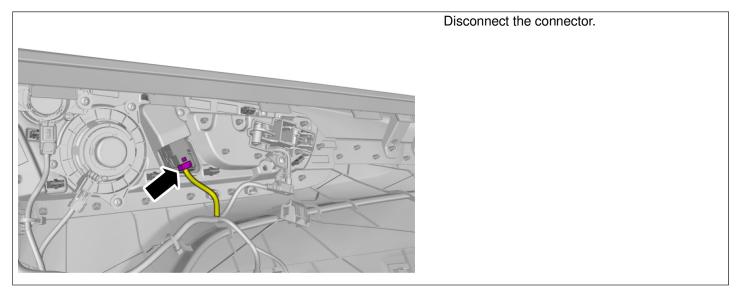

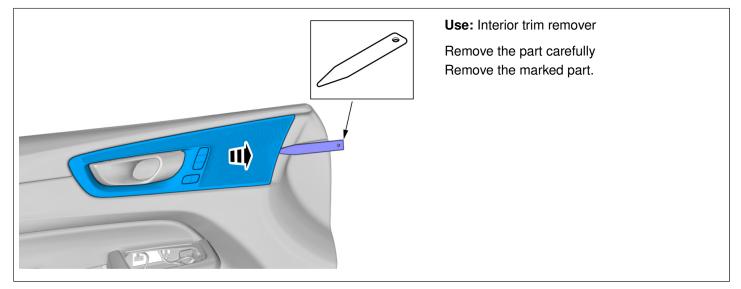



Vehicle with high performance sound system.

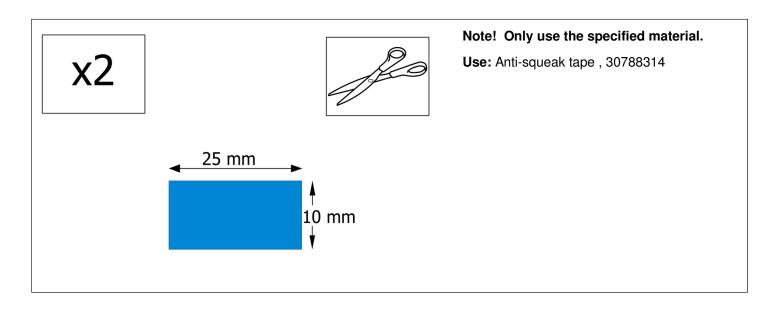

	Note! Note the position.
25 mm 50 mm	Install the marked components.

Vehicle with Premium sound system.

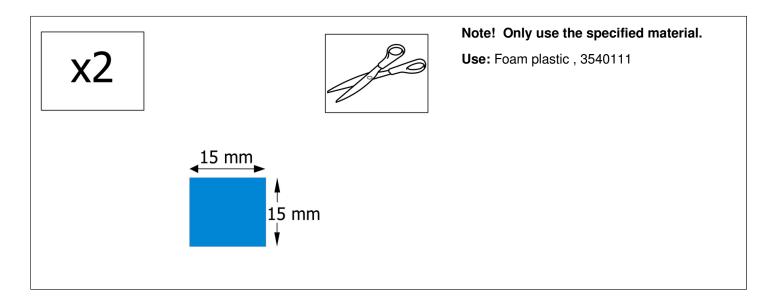

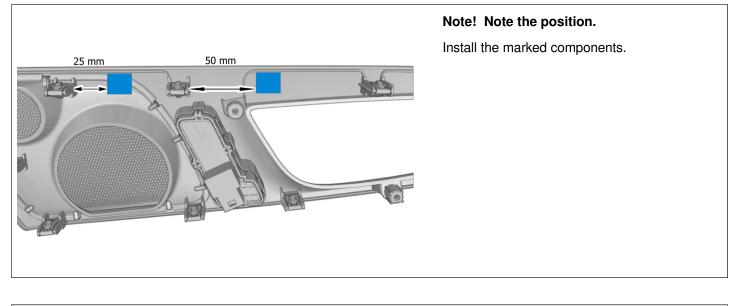

Repeat all method steps for the other side.

Installation

To install, reverse the removal procedure.