



## TECHNICAL SERVICE BULLETIN

### Various Drivability Concerns And/Or Illuminated Malfunction Indicator Lamp (MIL) - Built On Or Before 24-Jul-2018

**19-2091**  
22 March  
2019

This bulletin supersedes 18-2321. Reason for update: Missing or Incorrect Applications

#### Model:

<b>Ford</b> 2015-2018 Transit
----------------------------------

#### Summary

This article supersedes TSB 18-2321 to update the Service Labor Time Standards.

**Issue:** Some 2015-2018 Transit vehicles built on or before 24-Jul-2018 may exhibit various drivability concerns including difficulty starting, misfires and/or an illuminated MIL with diagnostic trouble codes (DTCs) P00BD, P1247, P1548, P061B, P2195, P2198, P2196, P2197, P0171, P0172, P0174, P0175, P0131 and/or P162F stored in the powertrain control module (PCM). This may be due to undesired water entry into the engine compartment directly over powertrain components. To resolve this condition, install updated water management hardware and/or a revised air cleaner cover.

**Action:** Follow the Service Procedure steps to correct the condition on vehicles that meet all of the following criteria:

- 2015-2018 Transit
- Built on or before 24-Jun-2018
- One of the following conditions:
  - Difficulty starting
  - Misfires
  - DTCs P00BD, P1247, P1548, P061B, P2195, P2198, P2196, P2197, P0171, P0172, P0174, P0175, P0131 and/or P162F stored in the PCM

#### Parts

Part Number	Description	Quantity
CK4Z-6102408-AA	Water Deflector	1
CK4Z-9601-A	Air Filter	1
4L3Z-18203A16-AA	Mastic Patch	1
CK4Z-61021A46-A	Leaf Screen Foam Seal	1
CK4Z-17C582-A	Wiper Arm Grommet	1
JK4Z-9661-A	Engine Air Cleaner Cover (2016-2018 3.7L)	1
JK4Z-9661-D	Engine Air Cleaner Cover (2016-2018 3.5L EcoBoost)	1
JK4Z-9661-B	Engine Air Cleaner Cover (2015-2018 3.2L, 2015 3.7L)	1
JU5Z-14A163-MA	Wire Harness Tie Strap Retainer	1
ZC-31-B	Motorcraft® Metal Surface Prep Wipes	1
TA-30	Motorcraft® Silicone Gasket And Sealant	1

**Warranty Status:** Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

### Labor Times

Description	Operation No.	Time
2015-2018 Transit 3.7L And 3.2L, 2016-2018 Transit 3.5L EcoBoost: Check Vehicle Repair History, Retrieve DTCs, And Replace The Air Cleaner Cover Includes Time To Apply Silicone For 2015 3.7L (Do Not Use With Any Other Labor Operations)	192091A	0.4 Hrs.
2015-2018 Transit: Check Vehicle Repair History, Retrieve DTCs, Reseal Cowl Area Following The Service Procedure, Includes Time To Replace Air Cleaner Cover as needed And Apply Silicone for 2015 3.7L (Do Not Use With Any Other Labor Operations)	192091B	0.9 Hrs.


### Repair/Claim Coding

Causal Part:	9601
Condition Code:	42

### Service Procedure

1. Check the vehicle build date and repair history. Was the vehicle previously repaired under FSA 15B39, TSB 15-0118, TSB 17-0014 or built on 30-Mar-2015 and through 24-Jul-2018?
  - (1). Yes - proceed to Step 2.
  - (2). No - proceed to Step 5.
2. Is the vehicle a 2015 equipped with a 3.5L EcoBoost engine?
  - (1). Yes - this article does not apply. Refer to the Powertrain Control/Emissions Diagnosis (PC/ED) Manual.
  - (2). No - proceed to Step 3.
3. Is the vehicle a 2015 equipped with a 3.7L engine?
  - (1). Yes - fill the vacuum port below the outlet on the new air cleaner cover with Motorcraft® Silicone Gasket And Sealant or equivalent. (Figure 1) Proceed to Step 4.
  - (2). No - proceed to Step 4.


Figure 1

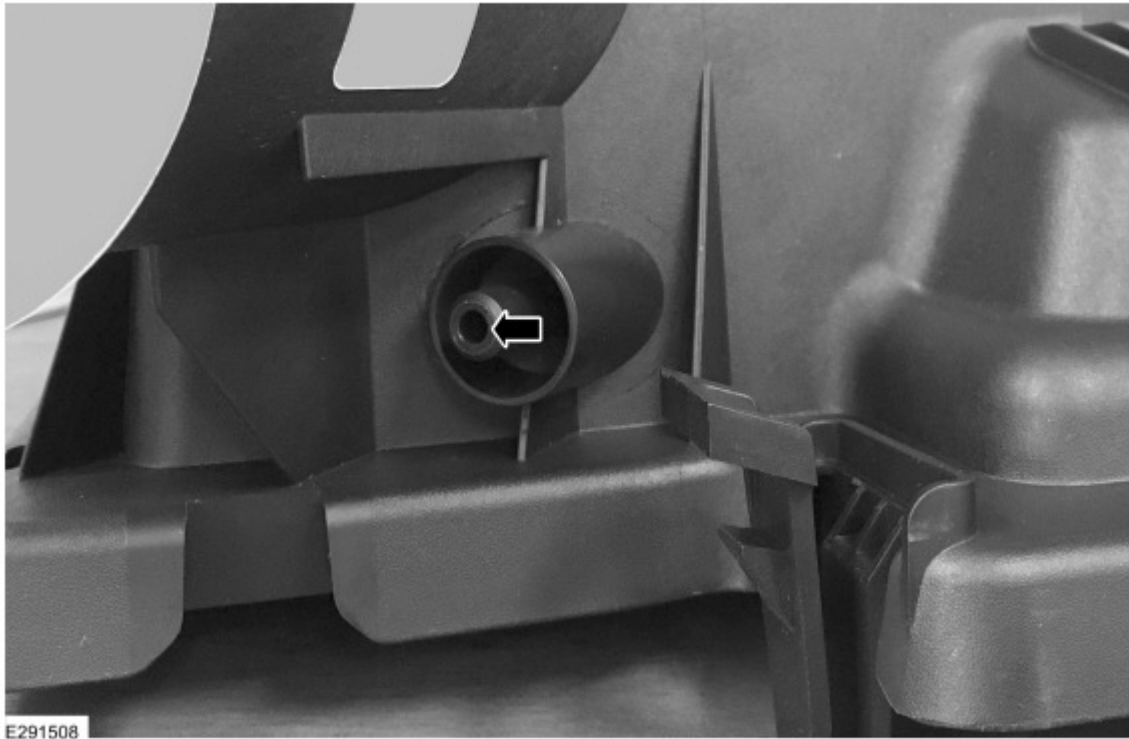

E291508

4. Replace the engine air cleaner cover. Refer to Workshop Manual (WSM) Section 303-12. While the air filter cover is off, remove the existing top mount wire harness retainer and replace with the side mount wire harness retainer (Figure 2). Repair is complete.

Figure 2

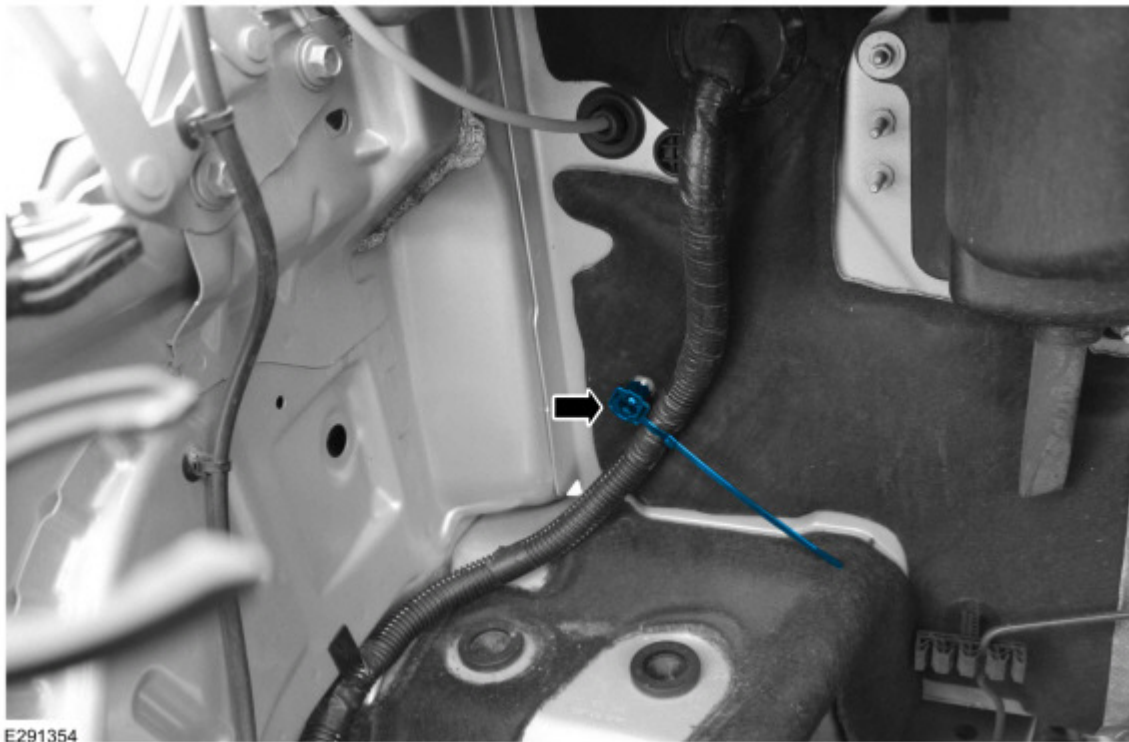

E291354

5. Using the appropriate Ford scan tool or equivalent, retrieve DTCs. Are DTCs P00BD, P1247, P1548, P061B, P2195, P2198, P2196, P2197, P0171, P0172, P0174, P0175, P0131 and/or P162F stored in the PCM or is there a customer drivability issue?


(1). Yes - proceed to Step 6.

(2). No - this procedure does not apply. Refer to the PC/ED Manual.

**6.** Remove the cowl panel grille. Refer to WSM, Section 501-02.

**7.** Clean the back of the cowl panel grille with a clean cloth. (Figure 3)

 Figure 3




E291355

**8.** Apply the leaf screen foam seal along the back of the cowl panel grille. (Figure 3)

**9.** Remove and discard the drain hose from the right side of the cowl panel grille. (Figure 4)

Figure 4

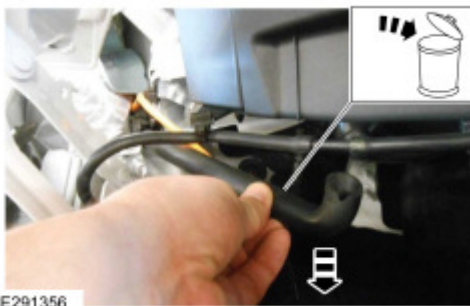


E291356

**10.** Remove and discard the engine air cleaner cover. Refer to WSM Section 303-12.

**11.** Clean the body joint between the right inner fender and dash panel with a Motorcraft® Metal Surface Prep Wipe or equivalent. (Figure 5)

Figure 5

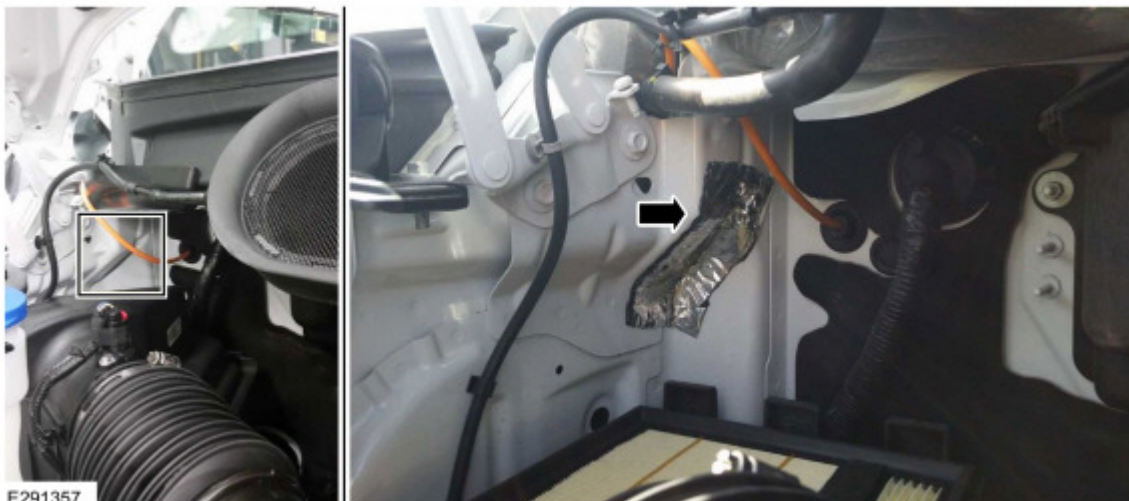

E291357

**12.** Cut the mastic patch to 8 cm x 13 cm (3 in x 5 in) and apply the patch to the body joint. (Figure 5)

- 13.** Remove and inspect the air cleaner element to determine if it is dry/damp or saturated with water or ice.
- (1). If the air cleaner element is dry/damp, clean any debris from the air cleaner tray and reinstall the air cleaner element. Normal engine operation will dry the element if damp.
  - (2). If the air cleaner element is saturated with water or ice, install a new air cleaner element.
- 14.** Is the vehicle a 2015 equipped with a 3.5L EcoBoost engine?
- (1). Yes - reinstall air cleaner cover. Refer to WSM Section 303-12. Proceed to Step 18.
  - (2). No - remove the existing top mount wire harness retainer and replace with the side mount wire harness retainer. (Figure 2)
- 15.** Secure the wire harness to the fastener.
- 16.** Is the vehicle a 2015 equipped with a 3.7L engine?
- (1). Yes - fill the vacuum port below the outlet on the new air cleaner cover with Motorcraft® Silicone Gasket And Sealant or equivalent. (Figure 1) Proceed to Step 17.
  - (2). No - proceed to Step 17.
- 17.** Install a new engine air cleaner cover. Refer to WSM Section 303-12.
- 18.** Is the vehicle a low roof model?
- (1). Yes - replace the right side windshield wiper arm grommet on the cowl panel grille. Proceed to Step 19. (Figure 6)
  - (2). No - proceed to Step 19.

Figure 6



E291358

- 19.** Reinstall the cowl panel grille. Refer to WSM Section 501-02.
- 20.** Install a new deflector on the right side of the vehicle. (Figure 7)
- (1). Install the outboard end of the deflector into the sheet metal tab behind the hood hinge.
  - (2). Snap the deflector onto the cowl panel grille.

Figure 7



**21.** Route the orange antenna wire in front of the deflector and route the washer hose under the inboard end of the deflector. Attach the washer hose clip to the front edge of the deflector. (Figure 7)

---

© 2019 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.