

| MFR Communication ID | MFR Communication Date | Make (Brand) | Model | Model Year | Text |
|----------------------|------------------------|--------------|--------------|------------|--|
| SSM 47899 | 3/27/2019 | Ford | Explorer | 2016 | Some 2017-2019 F-Super Duty, 2017-2019 Continental, and 2016-2018 Explorer/Police Interceptor Utility vehicles may exhibit a crank/no start condition, inoperative trailer tow lighting and/or inoperative power telescoping mirrors. This may be due to a concern within the battery junction box (BJB) relay module. A lower level service part has been released to allow for replacement of just the BJB relay module instead of the BJB harness. F-Super Duty part number HU5Z-14A067-A, Continental part number GU5Z-14A067-C, Explorer part number FU5Z-14A067-A, Police Interceptor Utility part number GU5Z-14A067-B. |
| | | | | 2017 | |
| | | | | 2018 | |
| | | | F-Super Duty | 2017 | |
| | | | | 2018 | |
| | | | | 2019 | |
| | | Lincoln | Continental | 2017 | |
| | | | | 2018 | |
| | | | | 2019 | |