

SSM 47823	<p>Various 2013-2019 vehicles may exhibit an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P264F after powertrain control module (PCM) replacement. This DTC indicates that the engine serial number (ESN) must be programmed into the PCM. The ESN is located on PTS> OASIS> Features> Engine Serial Number. Once the ESN is obtained from the historical vehicle bill of materials (HvBOM), it can be programmed into the PCM using the appropriate Ford diagnostic scan tool. Navigate to the toolbox tab> powertrain menu> Service Functions> ESN.</p>
-----------	----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------