

SSM 47824	Some 2015-2017 vehicles may experience a no crank concern due to a security access key table error. When attempting to program keys or perform a parameter reset, the procedure may fail and the Integrated Diagnostic System (IDS) scan tool may display an error 232: Key Table Not Allocated. If this error message is encountered, the Body Control Module (BCM) is internally faulted and requires replacement. For claiming, use causal part 15604 and applicable labor operations in section 10 of the Service Labor Times Standards (SLTS) manual.
-----------	--