

Transmission leak in area of oil pump

Topic number	LI27.00-N-066833
Version	1
Function group	27.00 General
Date	08-02-2017
Validity	All Sprinter Models with NAG 1 (5-speed automatic transmission)
Reason for change	
Reason for block	

Complaint:

Automatic transmission oil loss/ leak in the area of the oil pump and torque converter

Cause:

The oil pump seal spring ring may not be located correctly inside the oil pump seal.

Thus the seal cannot not be tightened as specified and is leaking.

Attachments	
File	Description
Spring Ring.pdf	Spring Ring Location

Remedy:

Replace oil pump seal ring only as per WIS instructions.

Do not replace the transmission!

Symptoms
Power transmission / Automatic transmission / Leakage / Leaks

Validity		
Vehicle	Engine	Transmission
*	*	722.680
*	*	722.681
*	*	722.683
*	*	722.684
*	*	722.682
*	*	722.685
*	*	722.686

XENTRY TIPS

Sprinter I	*	*
Sprinter II	*	*
Sprinter III	*	*