



Technical Service Bulletin

91 MIB2 High Scale: Assigned steering wheel button for Drive Select is lost

91 19 26 2053530/1 January 14, 2019.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|----------|-------------|-----------|----------------------------|
| A3, A4 | 2017 - 2018 | All | MIB2 High Scale |
| A5, Q5 | 2018 | All | MIB2 High Scale |

Condition

Customer states:

- The customer states that the assigned function of the programmable steering wheel button (star) for Drive Select is sporadically lost (Figure 1).
- The customer assigns "Drive Select" to the steering wheel button in the MMI, which initially works.
- However, after a certain amount of time, it is lost and the steering wheel button does revert to being unassigned.



Figure 1. Steering wheel assignable button for Drive Select.

Technical Background

The MIB2 software needs to be updated.

Production Solution

New infotainment software introduced into MY19.

Service

Required equipment:

- ODIS Tester
- SVM code



Technical Service Bulletin

- MIB2 High Software update on SD Card (See *Required Parts and Tools* or Download the software from MirrorServer using the SD Creator Program)

Time to complete update:

- Approximately 30-60 minutes (includes 20-50 minutes for the software update and 10 minutes for the SVM work)

Service work:

Update the MIB2 Scale infotainment system using either Method 1 or Method 2 according to TSB 2050565: *91 MIB2 High Scale Software Update Instructions (PR Code 7UH)* and use SVM code indicated below:

| Vehicle | SD Creator Part Number | SVM Code |
|--------------------|------------------------|------------|
| A3, A4, A5, and Q5 | 4M0 906 961 CD | MHS2US2037 |

Method 1: Automated update using ODIS

Method 2: Manual update due to SVM code or Server issues

Warranty

| | | | |
|--------------------------|---|--------------|---------------------------|
| Claim Type: | <ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If vehicle is outside any warranty, this Technical Service Bulletin is informational only. | | |
| Service Number: | 9196 | | |
| Damage Code: | 0039 | | |
| Labor Operations: | Software Update | 0151 0000 | According to TSB# 2050565 |
| Diagnostic Time: | GFF | No allowance | 0 TU |
| | Road test prior to service procedure | No allowance | 0 TU |
| | Road test after service procedure | No allowance | 0 TU |
| Claim Comment: | As per TSB #2053530/1 | | |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Required Parts and Tools

| Part Number | Part Description | Quantity |
|-------------|---|----------------|
| 4M0906961CD | MMI software update (SD Card) – Or download via SD creator Software | 01 (Shop tool) |

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2047812, *00 SD Creator: how to setup and use the SD Creator for obtaining vehicle software updates via the MirrorServer.*
- TSB 2050565: *91 MIB2 High Scale Software Update Instructions (PR Code 7UH).*

All part and service references provided in this TSB (2053530) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2019 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.