

LATEST VEHICLE CONCERN FIXES



High Pressure Fuel Pump Failure P0087	17-19MY RR, RRS, Discovery 3.0L TDV6 17-19MY XE, XF, F-PACE, RR Velar AJ20D
<p>Customer Voice:</p> <ul style="list-style-type: none">- Check Engine Light illuminated, Restricted Performance Message on IPC <p>Technical Description:</p> <ul style="list-style-type: none">- P0087-22/21 setting for fuel rail pressure sensor <p>Status:</p> <ul style="list-style-type: none">- Under Investigation- Ascertain the following information and include it in your TA submission:<ul style="list-style-type: none">✓ Follow all TOPIx procedures✓ 1L fuel sample in a clean container,✓ verify fuel quality✓ picture of the filter (hold onto the part & inspect for debris),✓ inspection of the pump (look for debris, signs rusting etc.),✓ find out from the customer last fueling event (how much, location of fueling station, station company, approximate date)✓ Diagnose any codes for injectors and hold onto those parts as well.✓ Retain all parts replaced for these codes. They will be requested for return	

