

LATEST VEHICLE CONCERN FIXES



Check Engine Lamp with DTC P0496 stored

Customer Voice:

- The Check Engine Lamp is on.

Technical Description:

- DTC P0496 is stored in the PCM.
- The fuel tank leak test routine and purge valve self test return passing results.
- This is caused by a bug in the software and is set when the gas cap is removed for refueling prior to the ignition being turned off.

Status:

- Reference SSM 74279 or SSM 74280.
- Ensure the vehicle does not have a hardware fault present and do not replace parts if no hardware fault is identified.
- Updated PCM software is currently scheduled for release in April 2019.

18-19MY Range Rover, Range Rover Sport, RR Velar, F-PACE, XE, XF equipped with AJ126 or AJ133

