

Service Information

Offboard Diagnostic Information System Service (ODIS Service) Number: VOS-19-15

Subject: Software Version Update, Enhancements and Fixes Date: June 12, 2019

Supersedes VOS-19-11 due to new diagnostic content version.

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: V5.1.5	Diagnostic Content: V2.39.2

Key Fixes/Enhancements for Diagnostic Content: V2.39.2:

- AU - Golf 2013 – 2019.**
 P049100: secondary air injection system (bank 1) insufficient flow static
 SYS_X_1_0916_11_X_X_SLS_FSB_00000 only verifies the barometric pressure and does not perform any further testing? Test only verifies the barometric pressure and does not activate the pump or test the system in operation.
- AJ - Jetta SportWagen/Golf Wagon 2010 – 2014, CJAA 2.0 L TDI CR / 103 kW.**
 -08- A/C/heating electronics DTC U101300: Control module not coded
 SYS87_____1_0309_66_codieren_00066 does not code A/C Control Module -J301- after a replacement.
- AU - Golf 2013 – 2019.**
 U044700: Invalid Data Received from Serial Data Gateway Module "A" is active/static in the ECM, but test plan SYS_X_1_0517_11_X_X_FSY_XX_FSB_Fahrzeugvernetzung_00000 states there in no fault in the DTC memory message.
- 7P - Touareg 2010 – 2017, CNRB 3.0 L TDI-CR / 176kW.**
 ECM DTC P159200: Altitude sensor signal/charge air pressure sensor Implausible ratio function test
 G31_X_1_0212_11_TDI01_X_Ladedruckgeber_00011 specified maximum pressure difference of 160 mbar for the Charge air pressure sensor -G31 and Barometric pressure sensor -F96 is too high. The specified maximum pressure difference is 75 mbar.
- BW - Tiguan 2018 – 2019.**
 B101F15: Seat position sensor, front passenger side Open circuit/short circuit to B+ test
 G554_A3_1_0613_11_00011 ends abruptly when option (1) "There is a customer complaint that you can assign to this event memory....." is selected.



Service Information

- **5N - Tiguan 2008 – 2018, CCTA 2.0 L Motronic / 147 kW.**
-0009- Electronic central electric replacement test
J519_X_1_1112_11_Steuergeraet_ersetzen_BCM_KWP_00011 ends with Adapt/calibrate Not OK but the Adapt/calibrate seems to have completed successfully and ended OK in the back end.
- **BU - Jetta 2018 – 2019.**
Function test J519_X_1_0119_11_Batteriepruefung_Funkfernbedienung_00000 for low key battery test is not translated from German to English.
- **General translation errors.**