

Technical Tip

	91-18-13TT - MIB2 Infotainment System - Component Protection Activated (Displayed) On Radio Without Previous Repairs or After Cluster Replacement	
Market area	United States 444 Volkswagen of America, Inc. (6444)	
Brand	Volkswagen	
Date	November 2, 2018	

Condition

ATTENTION:

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.

TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

MIB2 Infotainment System - Component Protection Activated (Displayed) on Radio without previous repairs or after Cluster Replacement

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
All	2016 - 2019	All	All	All	All

Technical Background

If component protection is activated (Figure 1) on the radio without any previous repairs or after replacing the instrument cluster, running the "KS-Master (Gateway) connection system" test plan will take the radio out of component protection.

Service

- 1. Connect O.D.I.S Service.
- 2. Navigate to and select the Special Functions tab.
- 3. Scroll down to the "25 Component protection functions" section.
- 4. Perform the "KS-Master (Gateway) connection system" test plan (Figure 2).



Figure 1



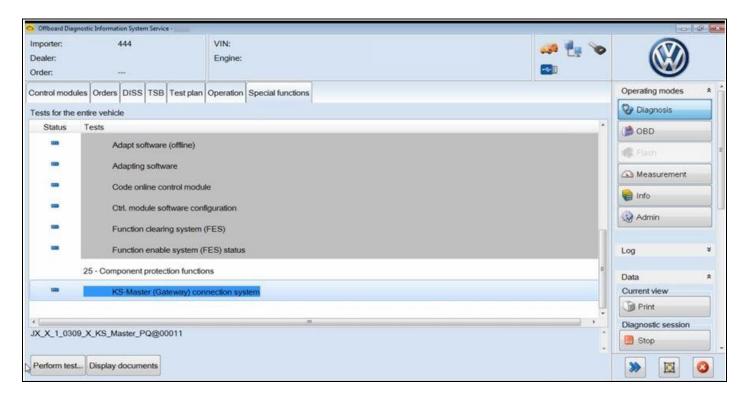


Figure 2

Additional Information

Revision History						
Revision Number	Released Date	Reason For Update				
2052844/1	11/2/18	Original publication.				

© 2018 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

2