#### ATTENTION:

 
GENERAL MANAGER

PARTS MANAGER

CLAIMS PERSONNEL

SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.



© 2019 Subaru of America, Inc. All rights reserved.

QUALITY DRIVEN® SERVICE

**NUMBER:** 07-152-19

**DATE:** 05/02/19

# **SERVICE BULLETIN**

**APPLICABILITY:** 2012-17MY Legacy and Outback

2014-16MY Impreza 2014-17 Crosstrek 2012-17MY Forester

2014-17MY WRX and WRX STI

**SUBJECT:** Power Window Switch Changes

## INTRODUCTION:

This bulletin announces availability of new power window switch assemblies developed to address the following customer concerns:

- Power windows inoperative from the driver's door master and / or passenger front door switch
- Unable to remotely operate other door windows from the driver's door master switch
- One-Touch Auto Up / Down features inoperative from either / both front door switches.

### PRODUCTION CHANGE INFORMATION:

The new switches were incorporated into production as per the table:

Model	Starting VIN		
Legacy	H3066346		
Outback	H3425714		
Impreza 4-Door	H3618034		
Impreza 5-Door	H3735852		
Crosstrek	HG272591		
Forester	HH592435		
WRX / STI	H8831964		

### PART INFORMATION:

**REMINDER:** Always order the most up-to-date replacement parts based on the specific VIN being repaired.

# CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.


# Subaru of America, Inc. is ISO 14001 Compliant

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Continued...

Bulletin Number: 07-152-19; Date: 05/02/19

Use the part number on the label to distinguish between the old and new switches as shown below:

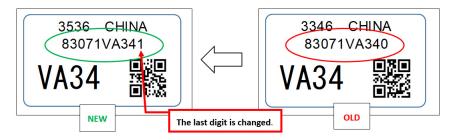

When diagnosis identifies a faulty Power Window switch, use the table below for determining which switch(s) to order and replace.

Power Window Switch Replacement Table								
Vehicle Model	Model Year	Main	Sub	Part Number	L/F Door (Main)	R/F Door (Sub)	Note:	
Legacy / Outback	2012-13	Х		83071AJ21B	R	R		
		Χ		83071AJ22B	R	R		
	2014 2015	Х		83071AL04B	R	N/A		
		Х		83071AL05C	R	R		
			Х	83071AL17B	N/A	R		
	2016-17	Х		83071AL34B	R	R	Silver	
			Х	83071AL37B	N/A	R		
		Х		83071AL38B	R	R		
		Х		83071AL44C	R	R		
1	Impreza 2014-16 X 83071F.J101 B							
Impreza 2014-16, Crosstrek 2014-17		X	 	83071FJ101	R R	N/A	Cilvor	
Crosstrek 2014-17 X 83071FJ111					K		Silver	
Forester -	2012-16	Х		83071SG011	R	N/A		
		Х		83071SG021	R	I N/A		
	2016-17	Х		83071SG071	R	R	Silver	
			Х	83071SG121	N/A	R		
	0044.45		l	000741/4044		Ъ		
WRX / WRX STI	2014-15	Х	 	83071VA011	R	R		
	2016-17	,,	Х	83071VA131	N/A	R	Silver	
	2015-17	Х		83071VA201	R	R		
		Х		83071VA331	R	R		

### **NOTES:**

- The table above does not include all sub-switch part numbers. Refer to the Electronic Parts Catalog (EPC) for the most up-to-date parts ordering and applicability information.
- "X" denotes whether the switch is a Main (driver's door) or a Sub (passenger front door switch).
- "R" means replace. On MOST Legacy / Outback models the Main and R/F (sub) switches should be replaced as a set.
- "N/A" means the corresponding Main or Sub switch does NOT need to be replaced.
- Always order the most up-to-date replacement switch(s) based on the specific VIN being repaired.

Continued...

#### SERVICE PROCEDURE / INFORMATION:

**REMINDER:** Customer satisfaction and retention starts with performing quality repairs.

The service procedures for power window switch replacement remain unchanged. Always refer to the applicable Service Manual and review the full requirements of the repair being performed before proceeding. The Service Manual procedures contain information critical to performing an effective repair the first time and every time.

**IMPORTANT REMINDER:** Whenever the battery is disconnected (or an applicable power window switch replaced), the power window initialization procedure must be performed to restore proper auto-up / down functionality.

## **WARRANTY / CLAIM INFORMATION:**

For vehicles within the Basic New Car Limited Warranty period or covered by an active Subaru Added Security Classic or Gold plan, refer to the Labor Time Guide on Subarunet for the proper claim coding information.

### **IMPORTANT REMINDERS:**

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.

Bulletin Number: 07-152-19; Date: 05/02/19