

	GROUP Electrical	MODEL 2017-18MY Forte (YDm) Soul (PS) Sportage (QL)
	NUMBER PS610	DATE June 2019
 		
SUBJECT: <p style="text-align: center;">SRS DTC B176200 AND/OR B168400</p>		

This Pitstop provides information regarding a possible mismatch of a SRSCM (Supplemental Restraint System Control Module) and driver seat belt buckle that may set the SRS DTC(s) B168400 and/or B176200 on the models listed below. When diagnosing a vehicle that has been in an accident and/or has recently had a superseded SRSCM replaced, it may be necessary to inspect and replace the driver seat belt buckle with the latest production P/N listed in EPC. Older production driver seat belt buckles have a 4 pin connector and may no longer be compatible with the superseded SRSCM. Only the SRSCM is superseded; the driver seat belt buckle is not superseded.

DTC B176200: ACU Coding Error
DTC B168400: Not Configured Device is Detected

Model	MY	SS SRSCM P/N	Updated Driver Seat Belt Buckle P/N
YDm	2017-18	95910 B0100	88830 B0550
PS		95910 B2600	88830 B2550
QL		95910 D9050	88830 D9550