

XENTRY TIPS

Airbag indicator lamp in instrument cluster active - fault code B272200 "Control unit not locked" stored in airbag control unit

Topic number	LI91.60-N-069798
Version	1
Function group	91.60 Airbag, pedestrian protection
Date	05-13-2019
Validity	Model 907
Reason for change	
Reason for block	

Complaint:

Customer complaint: Airbag indicator lamp in instrument cluster lights up.

Workshop findings: Fault code B272200 stored in airbag control unit (N2/5 - Supplemental Restraint System ORC177).

Cause:

Airbag control unit (N2/5) was not locked at the factory.

Remedy:

Commission airbag control unit (N2/5) with XENTRY Diagnosis.

N2/5 Supplemental Restraint System (SRS) --> Adaptations --> Commissioning

Symptoms

Body / Safety system / Airbag/Supplemental restraint system SRS / Indicator lamp / SRS indicator lamp / lit

Control unit/fault code

Control unit	Fault code	Fault text
N2/5 - Supplemental restraint system ORC177	B272200	The control unit is not locked. _

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
54-1011	PERFORM QUICK TEST	0.2		
54-0650	ON-BOARD POWER SUPPLY VOLTAGE MAINTAIN	0.1		

XENTRY TIPS

54-0992	CODE CONTROL UNIT SRS	0.1	82485 F1	Commission control unit
---------	-----------------------	-----	----------	-------------------------

Validity		
Vehicle	Engine	Transmission
Sprinter 907	*	*