

<b>Reference</b>	SSM74402
<b>Models</b>	XE / X760
<b>Title</b>	Unhelpful Headlight Control Module A&B (HCMA&B) DTCs when connected to JLR approved diagnostic tool.
<b>Category</b>	Body
<b>Last modified</b>	03-May-2019 00:00:00
<b>Symptom</b>	108000 Ext. Trim/Accessories
<b>Content</b>	<b>X760 XE 20MY Only.</b>

**Issue -**

**When connected to Pathfinder the following HCMA and/or HCMB DTCs may be set:**

**B10F3-16 - Left position light - circuit voltage below threshold**

**B10F4-16 - Right position light - circuit voltage below threshold**

**B124B-16 - Left Daytime Running Light - circuit voltage below threshold**

**B124A-16 - Right Daytime Running Light - circuit voltage below threshold**

**Cause -**

**HCM current and PCB voltage is out of phase causing erroneous DTCs as listed above.**

**Action -**

**No action is required. There is no detrimental effect on the headlamps performance, Do not replace the headlamp as the same DTCs will reoccur. New Software will be released with new low voltage threshold for DTC setting.**