

# LATEST VEHICLE CONCERN FIXES



## BECM Setting P3049-A2

### Customer Voice:

- Vehicle will not charge

### Technical Description:

- P3049-A2 is stored in the BECM for EV Battery Charger- High Voltage Supply Circuit. Vehicle may have performance concerns, range reduced warnings or charging concerns

### Status:

- Under Investigation
- Although stored in the BECM, this code describes a bus open fault with the BCCM in most cases.
- Perform the guided diagnostic- if none is available, test the vehicle on both AC & DC chargers. Check BCCM HV cables & connector for damage, continuity etc.
- Once the suggested tests are completed, please raise a TA with a session file for additional direction from engineering. If a replacement of the BCCM is required, hold onto the parts and provide PRR information for your parts manager in an EPQR.

## 19MY I-PACE

